

 FB-18333	T	9	NO OF TEETH	9001042299 1.01.0702.0 54-91106	For: Bosch Starters Used On: Mexican Applications
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	48	CLUTCH O/D		
	CCW		ROTATION		
 FB-18334	T	9	NO OF TEETH	9001043259 1.01.0672.0	
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18335	T	11	NO OF TEETH	9008042081	
	G	34.5	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18336	T	11	NO OF TEETH	9001042060 1.01.0673.0	NISSAN-DATSUN: Pick-up.S entra, Vanette
	G	34.5	PINION DIA		
	L	64	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18337	T	9	NO OF TEETH	9008042136 9007042024	
	G	25.8	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18338	T	9	NO OF TEETH	9001164126	
	G	25.8	PINION DIA		
	L	74	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		

 FB-18339	T	9	NO OF TEETH	66241324 54291912 LU-W0925	
	G	25.8	PINION DIA		
	L	48	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18340	T	9	NO OF TEETH	1006209650 1006209850 231009 1.01.1451.0	Hatz: Lombardini: Ruggerini: RD180,181,200 RF80,81,88,90,91,96,99,120, 121,130,140,148
	G	29.7	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	50.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18341	T	9	NO OF TEETH	9001690130 1.01.0886.0 BO-79923 42-42-78	
	G	29.5	PINION DIA		
	L	82.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18342	T	13	NO OF TEETH	ME700284 M191T65171 M191T66171 MT-35627B 6D22 8DC9 M5T50081 MT-35629C 18342A	
	G	56	PINION DIA		
	L	116	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18343	T	10	NO OF TEETH	CT352D37086 003 243708600 3708600-3 134723 137006 49-53-36 12021	BELARUS: MTZ50-MTZ52
	G	36.8	PINION DIA		
	L	106	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	16	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18344	T	18	NO OF TEETH	M191T78871 M2TS0571	
	G	13.4	PINION DIA		
	L	153/ 166.5	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		

 FB-18345	T	10	NO OF TEETH	12074	
	G	36.8	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18346	T	11	NO OF TEETH	8971797700 8970256720 4JBD2 4HF1200	ISUZU:
	G	40.5	PINION DIA		
	L	103.5	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64.6	CLUTCH O/D		
	CCW		ROTATION		

 FB-18347	T	11	NO OF TEETH	35261112 35262929 1.01.1617.0 35261260 35261295 35261640 KRQ1219-730	Ford : Ranger , Ranger Duratec HE 2.3
	G	34.5	PINION DIA		
	L	55.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		

 FB-18348	T	9	NO OF TEETH	26258286	TATA ACE /INDIGO
	G	25.8	PINION DIA		
	L	52.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CW		ROTATION		

 FB-18349	T	10	NO OF TEETH	1006209621 1006209648 1006209699 1006209880 02T911335 136854 1.01.0937.0 54-91127-1	Audi: A 3 1.9 TDI Ford: GALAXY 2.0 Seat: Vento Tdi 1.9, IBIZA 1.9 D/TD Volkswagen: VENTO 1.9 TDI, BEETLE 1.9 TDI, BORA 1.9 TDIBUS EUROVAN, CARAVELLE 1.9, GOLF III 1.9 TDI, MULTIVAN, POLO 1.9 TDI, SHARAN 1.9 TDI
	G	27.8	PINION DIA		
	L	80.5	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	52	CLUTCH O/D		
	CCW		ROTATION		

 FB-18350	T	9	NO OF TEETH		
	G	37	PINION DIA		
	L	155	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D	56	CLUTCH O/D		
	CCW		ROTATION		



FB-18351

T	9	NO OF TEETH
G	29.5	PINION DIA
L	133	LENGTH
SPL		NO OF SPLIN
ID	15.9	BUSHING DIA
D	50	CLUTCH O/D
CCW		ROTATION



FB-18352

T	10	NO OF TEETH
G	39.5	PINION DIA
L	130	LENGTH
SPL		NO OF SPLIN
ID	15.9	BUSHING DIA
D	52	CLUTCH O/D
CCW		ROTATION



FB-18353

T	12	NO OF TEETH
G	46	PINION DIA
L	98	LENGTH
SPL	3	NO OF SPLIN
ID	14.3	BUSHING DIA
D	60	CLUTCH O/D
CW		ROTATION

1985262
4-338
131481
54-132-4
54-132-1-S
1.01.0858.0
10640

Case: Caterpillar: Clark
Cummins:Cummins c/
partida Delco Remy 37MT
12/24V 12D (Caminhões
GMC, MB, VW).
IHC:
Lister:
Perkins:
Waukesha
Delco Remy:Série 37MT
12/24V (MB, VW, Ford, GMC,
Cummins, Caterpillar
General Motors:Caminhões
c/ motor Caterpillar e partida
Delco Remy 37MT 12/24V.
For:
Delco 37MT Series DD
Starters

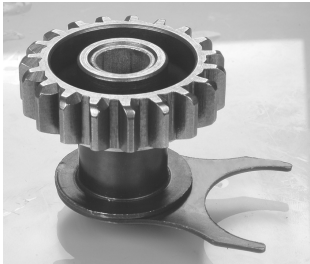
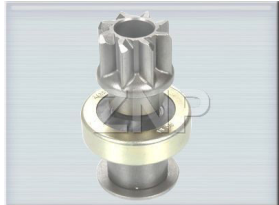


FB-18353A

T	12	NO OF TEETH
G	46	PINION DIA
L	98	LENGTH
SPL	3	NO OF SPLIN
ID	14.3	BUSHING DIA
D	60	CLUTCH O/D
CW		ROTATION

1985262
1.01.0624.0
4-338DR
54-132-2
54-132-1-D
DR-A12467

Case: Caterpillar: Clark
Cummins:Cummins c/
partida Delco Remy 37MT
12/24V 12D (Caminhões
GMC, MB, VW).
IHC:
Lister:
Perkins:
Waukesha
Delco Remy:Série 37MT
12/24V (MB, VW, Ford, GMC,
Cummins, Caterpillar
General Motors:Caminhões
c/ motor Caterpillar e partida
Delco Remy 37MT 12/24V.
For: Delco 37MT Series DD
Starters

 FB-18354	T	9	NO OF TEETH	2006209470 2006209483 9001451343 79026030 9936730 9937949 9956676 9983629 SD184 4-850 130950 1.01.0291.0 54-9117	Alfa Romeo: 30, 32, 35, 40 AR8. Alfa Romeo: 30 - 32 - 35 - 40 (AR 8) Fiat: Argenta 2.5Campagnola diesel.Marengo D 2.5. 131D (2.0 e 2.5), 132D (2.0 e 2.5), 40NC, 50F8, 50NC, 241TN, 465C, 466DT, 480DT, 500, 500DT, 505, 505C, 505S, 540, 540DT.55F8, 55NC, 565C, 566DT, 570, 570DT, 580, 580DT, 60F8, 616N3-4,625N3P, BI20-25-3 C,BIM20-25,DI12-15, DT450, R450. Fiat Allis: 480 - 500 - 540 - 570- 580, FL 4C Fiat Iveco Ducato 10, 13, (2.5D).Ducato 10,13 (2.5D) OM: BI 20 - 25 - BIM 20 - 25 - DIM 20, GRINTA 28.8 - 30.8 - 32.8 - 35.8
	G	34.7	PINION DIA		
	L	74	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18355	T	19	NO OF TEETH	1S7U11000BA STM583-800 234504 SD9017	1S7U11000BA/1S7U11000B A/1S7U11000BB/1S7U11000 BB/1S7U11000BC/1S7U110 00BC/31CA11000AB, 31CA11000AB, XS7U11000AB, XS7U11000AB, XS7U11000BA, XS7U11000BA
	G	54.5	PINION DIA		
	L	46	LENGTH		
	SPL		NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		
 FB-18356	T	8	NO OF TEETH	F002G20160	
	G	28	PINION DIA		
	L	46	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18357	T	8	NO OF TEETH	26259221 1.01.1513.0	FORCE MOTORS/MINIDOR
	G	28.4	PINION DIA		
	L	71.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CW		ROTATION		
 FB-18358	T	11	NO OF TEETH	NE834 185915 594185 135389 1.01.1023.0	JPX: Jeep c/ partida Valeo. Peugeot: 405 diesel Renault: Renault. Volvo: 440TD, 460TD VALEO
	G	29.5	PINION DIA		
	L	54.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18359	T	9	NO OF TEETH	9002336224 9002336287 230546 1.01.1072.0	Citroën: Jumper 2.5 D-TD Fiat: DUCATO 2.5 TD Peugeot: Boxer 2.5 - TD605TD
	G	29.5	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18360	T	11	NO OF TEETH	9002336230 137275 54-9192 4-1070 1.01.0929.0 BO-AHB13422	For: Bosch 218 Series PLGR Starters Used On: Deutz, Ditch Witch KHD: BF4L1011
	G	35.8	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18361	T	10	NO OF TEETH	1006209560 1006209569 1006209908 131434 1.01.0962.0	Ford: COURIER 1.8 D, ESCORT 1.8 TD, FIESTA 1.8 D, MONDEO 1.8 TD, ORION 1.8 TD
	G	26.8	PINION DIA		
	L	59	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18362	T	9	NO OF TEETH	9002336283 9003336283 9939710 131996 135527 1.01.0875.0 BO-AH93622 42531397	Citroën: JUMPER 2.8D TURBO Fiat: ARGENTA D, CROMA D – TD, DUCATO D Fiat Iveco: DAILY 2.8 TD 12 V, OTOYOL KAMYONET, OTOYOL MINIBUS Lancia: Thema turbo diesel. Renault: Master, P35, T35 diesel.Trafic diesel.
	G	35.5	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	52	CLUTCH O/D		
	CW		ROTATION		
 FB-18363	T	9	NO OF TEETH	9003336282 234403 1.01.0838.0 BO-AH93422 0001218161 9000331418 SDV38166 CSD-188	Fiat Iveco: Ducato Argentino ano 97. MWM: Diter D302, D325, D889, D890, D900, D989.
	G	34.8	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		



FB-18364

T	10	NO OF TEETH	2006209200
G	32	PINION DIA	2006209201
L	91	LENGTH	2006209306
SPL	10	NO OF SPLIN	2006209346
ID	14.3	BUSHING DIA	2006209414
D	60	CLUTCH O/D	2006209444
CW		ROTATION	9002453077
			9008044016
			TNB408
			SD018
			4-743A
			132697
			131495
			54-9114-2
			1.01.0304.0
			1.01.0497.0
			BO-L0329

JohnDeere(SLC):John Deere,1020U, VU. 1630, 2030OU, JD300, JD310, JD350, JD400, JD450, MD1020, MD1120, MD1530, MD1630, MD1830, MD2030, MD2130, MD3130, MD330, MD820, MD820VU, MD830, MD290, MD925, MD930, MD935, MD940, MD942, MD945, MD950, MD952, MD955, MD960, MD965, MD968, MD969, MD970, MD975.
Müller:1020OU/VU, 1630, 2030OU, JD300, JD310, JD350, JD400, JD450, MD1020, MD1120, MD1530, MD1630, MD1830, MD2030, MD2130, MD3130, MD330, MD820, MD820VU, MD830, MD920, MD925, MD930, MD935, MD940, MD942, MD945, MD950, MD952, MD955, MD960, MD965, MD968, MD969.



FB-18365

T	9	NO OF TEETH	9008042133
G	25.8	PINION DIA	
L	68.5	LENGTH	
SPL	10	NO OF SPLIN	
ID	12	BUSHING DIA	
D	47.5	CLUTCH O/D	
CCW		ROTATION	



FB-18366

T	40	NO OF TEETH	028099-3130
G	53.8	PINION DIA	028300-2081
L	64	LENGTH	028300-2220
SPL	10	NO OF SPLIN	028300-3930
ID		BUSHING DIA	134806
D		CLUTCH O/D	54-82402
CW		ROTATION	1.01.1215.0
			1.01.0921.1
			17381-63041

Toyota: HI LUX 2.8 D, LAND CRUISER
Volkswagen: TARO
For: Nippondenso OSGR Starters
Used On: (1998-72) Acura, Chevrolet, Chrysler, Daihatsu, Dodge, Geo, GMC, Honda, Isuzu, Lexus, Plymouth, Toyota; Caterpillar, Ford New Holland, Harley-Davidson, Hyster, Ishikawajima, Kubota, Mitsui-Deutz, Teledyne, Toyota Lift Truck



FB-18367

T	40	NO OF TEETH	028300-0010
G	53.8	PINION DIA	028301-0010
L	52	LENGTH	028301-0190
SPL	10	NO OF SPLIN	135974
ID		BUSHING DIA	4-1071
D		CLUTCH O/D	54-82401
CW		ROTATION	1.01.0750.1
			1.01.1201.0

Chrysler: FIFTY AVENUE - LEBARON
For: Nippondenso OSGR Starters
Used On: (2005-90) Acura, Chevrolet, Chrysler, Dodge, Eagle, Geo, Honda, Isuzu, Lexus, Plymouth, Toyota; Harley-Davidson

 FB-18368	T	10	NO OF TEETH	F002G20319 F000AL1100 1006209680 1006209962 230340 1.01.1069.0 54-9197	Audi: A3 1.6, 1.8 e 1.8 Turbo Seat: Alhambra 2.0Cordoba 1.6Ibiza Cupra / Sport 1.8 20V turboVario 1.6 Volkswagen: BEETLA 2.0, GOLF IV 1.8 GTI, GOLF IV 1.8 GTI TURBO, GOLF IV 1.8 MOTION, GOLF IV 2.0 VARIANT, Golf 1.8 4 Motion, POLO 1.0 16V, POLO 1.6, POLO 2.0
	G	28	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18369	T	8	NO OF TEETH	1006209613 138233 4-1032 54-9160 1.01.0852.0	Chrysler: Néon
	G	28	PINION DIA		
	L	52	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18370	T	30	NO OF TEETH	M191T69671	
	G	21.5	PINION DIA		
	L	90	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	10.7	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CCW		ROTATION		



FB-18371

T	10	NO OF TEETH
G	27.8	PINION DIA
L	49	LENGTH
SPL	10	NO OF SPLIN
ID	12	BUSHING DIA
D	50.5	CLUTCH O/D
CW		ROTATION

0011511513
1006209642
138322
1.01.1057.0
54-15642

Mercedes: C 200 diesel T, 2.2, 70KW, a partir de 05/96. C 200 diesel, 2.0, 55KW, de 03/93 a 08/95. C 200 diesel, 2.0, 65KW, a partir de 09/96. C 220 diesel, 2.2, 70KW, a partir de 08/93. C 250 diesel turbo, 2.5, 110KW, a partir de 09/95. E 200 diesel, 2.0, 65KW, a partir de 03/97. E 220 diesel, 2.2, 70KW, a partir de 06/95. E 250 diesel T, 2.5, 83KW, a partir de 05/96. E 250 diesel, 2.5, 83KW, a partir de 06/95. E 290 diesel turbo T, 2.9, 95KW, a partir de 05/96. E 290 diesel turbo, 2.9, 95KW, a partir de 01/96. Sprinter 208 diesel 2.3, 58-60KW, a partir de 02/95. Sprinter 210 diesel, 2.9, 75KW, a partir de 01/97. Sprinter 212 diesel, 2.9, 90KW, a partir de 02/95. Sprinter 308 diesel, 2.3, 58KW, a partir de 02/95. Sprinter 310 diesel, 2.9, 75KW, a partir de 01/97. Sprinter 312 diesel, 2.9, 90KW, a partir de 02/95. Sprinter 408 diesel, 2.3, 58KW, a partir de 02/95. Sprinter 410 diesel, 2.9, 75KW, a partir de 01/97. Sprinter 412 diesel, 2.9, 90KW, a partir de 02/95. V 230 TD, 2.3, 72KW, a partir de 04/96. Vario O 812 diesel, 2.9, 90KW, a partir de 09/96. Vario 512 diesel, 2.9, 90KW, a partir de 09/96. Vario 612 diesel, 2.9, 90KW, a partir de 09/96.



FB-18372

T	17	NO OF TEETH
G	39.2	PINION DIA
L	91.5	LENGTH
SPL		NO OF SPLIN
ID		BUSHING DIA
D	54.5	CLUTCH O/D
CCW		ROTATION

230762
1.01.0751.0
54-8505
SM13
3084981

Kawasaki: ATV 300 4x4. Magnum 2x4, Magnum 4x4, a partir de 94. Polaris - ATV 300 4x4, 400L 2x4, 400L Big Boss 6x6, Magnum 4x4 a partir de 94, Sportman 4x4. Sportsman 4x4. Trail Boss 250. Trail Boss 250, Xplorer 4x4 (todos exceto 325cc.). Xplorer 4x4. 400L 2x4, 400L Big Boss 6x6.

Polaris:



FB-18373

T	11	NO OF TEETH
G	40.5	PINION DIA
L	84	LENGTH
SPL	12	NO OF SPLIN
ID	15	BUSHING DIA
D	61	CLUTCH O/D
CW		ROTATION

0-23000-1031
0-23000-1050
0-23000-1070
0-23000-1071
0-23000-1080
0-23500-0590
1-23500-0010
135542
54-8412
4-1059
1.01.0894.0
NIK-209

For: Nikko 4.5kW OSGR Starters
Used On:
Kobelco America

APC151

 FB-18374	T	9	NO OF TEETH	1006209657 1006209757 1007010105 F000AL1086 047911335E 230339 1.01.1108.0 54-91104-1	Audi: A3 1.6 - 1.8 T, TT Seat: Alhambra 1.8T - 2.0, Córdoba 1.6, 1.8, 2.0, Ibiza 1.6, Leon 1.4, 1.6, 1.8, 1.8T, Toledo 1.4, 1.6, 1.8 Skoda: Octavia 1.6, 1.8, 1.8T, 2.0 Volkswagen: Bora 1.6 Variant, Bora 1.6, 2.0, Golf IV 1.4, 1.6, 1.8, 2.0, New Beetle 1.8, 2.0, Pólo 1.6, 1.8, Sharan 1.8T, 2.0, Transporter 2.0
	G	25.8	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CCW		ROTATION		
 FB-18375	T	9	NO OF TEETH	1006209634 1006209660 1006209779 1006209959 F002G20142 12411740373 137888 234902 1.01.0997.0 54-91101-1	Alfa Romeo: 156 JTD BMW: 316, 318, 325 (E 36), 5 Series (E 34 - E 36), 728 (E 38) Fiat: BRAVA/O 1.9 TD, MAREA 1.9 TD Ford: GRANADA, SCORPIO 1.8 - 2.0, TRANSIT 1.6 - 2.0 Opel: FRONTERA 2.5 TD
	G	29.5	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18376	T	11	NO OF TEETH	1006209578 1006209923 135464 1.01.0805.0	Lada: SAMARA 1.1 - 1.3 - 1.5
	G	29.5	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18377	T	11	NO OF TEETH	1006209541 132204 1.01.0800.0	Citroën: BX 17 D - 19 D, JUMPER 1.9D, VISA 17 D Peugeot: 205 D, 305 D, 309 D, 405 D Talbot: HORIZON D, SOLARA D
	G	29.5	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18378	T	11	NO OF TEETH	SF-312	
	G	40.6	PINION DIA		
	L	93	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	71	CLUTCH O/D		
	CW		ROTATION		

 FB-18379	T	11	NO OF TEETH	1L5T11000AA 1L5Z11002AA 6S4Z11002AA XW4U11000A C XW4Z11002A C 54-218 1.01.1585.0 C2C-1127	For: Ford PMGR, PMGR External Thru Bolt Starters Used On: (2005-00) Ford, Jaguar, Lincoln, Mazda Ford: ESCAPE 2.3L(140) L4 2005-2006, FOCUS 2.3L(140) L4 2003-2006, RANGER 2.3L(140) L42001-2006 Jaguar: S-TYPE 3.0L 2000-2004 Lincoln: LS 3.0L(182) V6 2000-2004 Mazda: B SERIES PICKUPS 2.3L 2001-2006, TRIBUTE 2.3L 2005-2006 Mercury: MARINER 2.3L(140) L4 2005-2006
	G	34.3	PINION DIA		
	L	46.6	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18380	T	10	NO OF TEETH	54291735 TMB182 133591 1.01.0820.0	Ford: COURIER, ESCORT III 1.6 D - 1.8 D, FIESTA 1.6 D - 1.8 D, ORION 1.6 D - 1.8 D, SIERRA
	G	26.8	PINION DIA		
	L	50.5	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		

 FB-18381	T	11	NO OF TEETH	SC0396	
	G	35.5	PINION DIA		
	L	53	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.3	CLUTCH O/D		
	CW		ROTATION		

 FB-18382	T		NO OF TEETH	486038	
	G	23.7	PINION DIA		
	L	120	LENGTH		
	SPL	19	NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D	57.8	CLUTCH O/D		
	CW		ROTATION		

 FB-18383	T	9	NO OF TEETH	23300-W9810 23354-W9810 M191T12971 1.01.1592.0 137218 54-8342-1 SD-6104	Nissan - Datsun: LIFT TRUCKS AEH Z24 Engine, LIFT TRUCKS H01 A15 Gas Engine, LIFT TRUCKS KCH02 H20 Gas Engine, LIFT TRUCKS Various Models H30 Engine TCM EQUIPMENT Ag: LIFT TRUCKS FHG20N H25 Engine, LIFT TRUCKS FHG30N Z24 Engine
	G	29.6	PINION DIA		
	L	74	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	10.7	BUSHING DIA		
	D	45.7	CLUTCH O/D		
	CW		ROTATION		

 FB-18384	T	19	NO OF TEETH	1054B-4D30 LH-4150 M2T56181 LTH209 SDR6012	Hyundai : H 100 , Migthy Truck
	G	14.7	PINION DIA		
	L	117/135	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	65	CLUTCH O/D		
	CW		ROTATION		
 FB-18385	T	8	NO OF TEETH	M191T26171 23312-M8011 133268 4-888 1.01.0519.0 MT-115BA SDMI-2391	Nissan – Datsun: CHERRY, GA13, GA15, G16, PULSAR, SENTRA, SUNNY Subaru: JUSTY 1.2
	G	28.4	PINION DIA		
	L	70.5	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CCW		ROTATION		
 FB-18386	T	10	NO OF TEETH	186321 188993 198993 594251 594410 NE885 36100-42300 36160-42300 36160-47300 139905 231932 1.01.1162.0 1.01.1607.0 1.01.1692.0 PG-113-7 PG-100-47	Renault: Laguna D RN, RT, RXE Hyundai: HR H100 Mitsubishi : Katana L200 Diesel OPEL: MOVANO 2.2 DTi RENAULT : ESPACE IV - LAGUNA II - VEL SATIS 2.2 DCiMASTER 2.2 Dc 36-46-23 CS964
	G	32.7	PINION DIA		
	L	55	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18387	T	10	NO OF TEETH	186020 185441 594108 NE830 TDB441 135083 1.01.0747.0 54-9436-1 PG-100-1	Autobianchi: Y10 FIRE Opel: CORSA 1.0 - 1.4 Renault: CLIO 1.2 - 1.4, LAGUNA 1.8 - 2.0 220-40029 26-46-93 221294
	G	28	PINION DIA		
	L	51.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18388	T	9	NO OF TEETH	3471040 3471490 3471912 DR2000 DR2001 DR2003 130465 4-652 1.01.0243.0 344511	Opel: ASCONA, KADETT C
	G	25.8	PINION DIA		
	L	66	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18389	T	9	NO OF TEETH	M191T40271	
	G	29.5	PINION DIA		
	L	64	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18390	T	10	NO OF TEETH	26252761	ITD
	G	39.4	PINION DIA		
	L	71.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18391	T	10	NO OF TEETH	1006209629 1006209929 137981 1.01.0938.0	Ford: COURIER 1.6 16v, FIESTA 1.2 - 1.4 16v
	G	27	PINION DIA		
	L	47	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		

 FB-18392	T	9	NO OF TEETH	1006209605 1006209606 1006209928 139013 54-9193 1.01.1474.0	
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		

 FB-18393	T	9	NO OF TEETH	1006209580 135713 1.01.0797.0 1855 52-42-24	Seat: TERRA 1.4 D Volkswagen: POLO 1.4 D
	G	25.8	PINION DIA		
	L	55.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18394	T	8	NO OF TEETH	1006209614 F000AL2000 234945 1.01.1467.0	Nissan – Datsun: Sentra 94
	G	27.2	PINION DIA		
	L	66.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		

 FB-18395	T	9	NO OF TEETH	9001042100A	
	G	25.8	PINION DIA		
	L	64	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18396	T	9	NO OF TEETH	1006209564 136925 4-822 54-9165 1.01.0803.0	Ford: SCORPIO, SIERRA 2.8 Jeep: CHEROKEE SE 1994 L4 2.5 GAS, WRANGLER SE 1994 L4 2.5 GAS Saab: Coupè, 9000, 900 S 1998 L4 2.3 GAS, 900 SE TURBO 1997 L4 2.3 GAS, 900 Turbo, 9000 AERO 1997 L4 2.3 GAS, 9000 CD 1994 L4 2.3 GAS, 9000 CDE 1994 L4 2.3 GAS, 9000 CS 1997 L4 2.3 GAS, 9000 CSE TURBO 1998 L4 2.3 GAS, 9000 CSE 1994 L4 2.3 GAS, 9000 GRIFFIN EDITION 1992 L4 2.3 GAS, 9000 S 1992 L4 2.3 GAS, 9000 SPG 1991 L4 2.3 GAS
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18397	T	11	NO OF TEETH	42113708600-09	
	G	29.7	PINION DIA		
	L	65	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	52	CLUTCH O/D		
	CW		ROTATION		
 FB-18398	T	9	NO OF TEETH	42113708600-08 42163708-07 4216370807 6012370800 1.01.1176.0	Volga : VOLGA WITH 406 ENGINE
	G	25.5	PINION DIA		
	L	65	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	52	CLUTCH O/D		
	CW		ROTATION		
 FB-18399	T	11	NO OF TEETH	QDJ2811A 2236 220-3	
	G	41	PINION DIA		
	L	100.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	62	CLUTCH O/D		
	CW		ROTATION		
 FB-18400	T	10	NO OF TEETH	26258562	JOHN DEERE TRACTOR
	G	32	PINION DIA		
	L	92	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18401	T	9	NO OF TEETH	26240605 1.01.1527.0	TATA: D1015 TC, LPT1510, LPT1613 48 CM VR 2000, LPT1613 52, LPT1613 CM VR 2000, LPT1613 TC, LPT1613 TC 48, LPT1615 TC, SA 1212 TC, SAK 1212 TC, SE 1615 TC, TATA 713
	G	35	PINION DIA		
	L	101	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18402	T	12	NO OF TEETH	97CA11000AB IS7U11000BA YC1U11000AB STM583-800 233830 1.01.1539.0 CS1245	Ford: transit 2.4 e Mondeo.
	G	38	PINION DIA		
	L	47	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18403	T	8	NO OF TEETH	1006209615 6004AH5018 1.01.1478.0 54-91115-1	
	G	27	PINION DIA		
	L	47	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		

 FB-18404	T	9	NO OF TEETH	1006209753 233841	ROVER : 111 - 114
	G	25.8	PINION DIA		
	L	67	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		

 FB-18405	T	13	NO OF TEETH	106688 10670F7RU F7RUK614 97VB-11000-A A 139341 1.01.0907.0	Ford: TRANSIT 2.5 D STM5010/986020181 DRS3535/25-2187/10279 28/1059179/1073108 1093471/97VB11000AA 97VB11000AB/98VB1100 0B1A/98VB11000B3A 98VB11000B3B/R98VB11 000B1A/CS977/LRS0097 6/455895/F47-08
	G	46	PINION DIA		
	L	46	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18406	T	10	NO OF TEETH	F000AL1024 F000AL2024 6004AA3009 9008047011 54-91114 1.01.1470.0	Chrysler: Dodge RAM
	G	33	PINION DIA		
	L	58	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18407	T	9	NO OF TEETH	95956	Peugeot: 504 D , 505 D, 604 TD, J7 D, J9 D Renault Agri: R 7221 SDPA-2024 6108-2024 6190-2972 26-46-07 26-46-20
	G	37	PINION DIA	095956	
	L	76	LENGTH	095958	
	SPL	12	NO OF SPLIN	NE175	
	ID	14	BUSHING DIA	NE176	
	D	57	CLUTCH O/D	SD813	
	CW		ROTATION	130761	
 FB-18408	T	10	NO OF TEETH	54-9413	John Deere (SLC): John Deere JD310, JD350, JD400, JD410, JD450, MD1040, MD1065, MD1075, MD1085, MD1140, MD1640, MD1840, MD20401, MD2140, MD3040, MD3140, MD840, MD932, MD940, MD942, MD952, MD955, MD958, MD965.
	G	32	PINION DIA	1.01.0216.0	
	L	91	LENGTH	PG-202	
	SPL	10	NO OF SPLIN	2006209427	
	ID	14.3	BUSHING DIA	2006209457	
	D	60	CLUTCH O/D	2006209459	
	CW		ROTATION	132345	
 FB-18409	T	9	NO OF TEETH	4-929	J 7DIESEL PARIS RHONE SG1 PARIS RHONE
	G	37	PINION DIA	54-9150	
	L	76	LENGTH	1.01.0635.0	
	SPL	6	NO OF SPLIN	BO-B0329	
	ID	14	BUSHING DIA	61-15-6489	
	D	57	CLUTCH O/D	220-24053	
	CW		ROTATION	42-42-71	
 FB-18410	T	9	NO OF TEETH	SDBO-2635	Ford: Granada 1.9, 2.0 diesel Peugeot: 504D, 505D turbo, 604D turbo.
	G	36.5	PINION DIA	W470-95	
	L	74	LENGTH	077756	
	SPL	10	NO OF SPLIN	NE162	
	ID	14.3	BUSHING DIA	PG-201	
	D	60	CLUTCH O/D	26-46-01	
	CW		ROTATION		
 FB-18411	T	12	NO OF TEETH	26245134	TATA INDICA
	G	32	PINION DIA		
	L	51.5	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18412	T	10	NO OF TEETH	M191T12171	Ford: PROBE Mazda: 626 2.0 - 2.2 / Turbo, B 2200 Pick up, MX 6 2.0 - 2.2 / Turbo Nissan-Datsun: STANZA 2.0 4WD
	G	31.6	PINION DIA	M191T13271	
	L	51	LENGTH	M191X13271	
	SPL	8	NO OF SPLIN	23354-20R10	
	ID	12	BUSHING DIA	F21418X25	
	D	45.6	CLUTCH O/D	E92Z11350A	
	CW		ROTATION	E92Z11350B	

 FB-18413	T	44	NO OF TEETH		Skoda:
	G	45	PINION DIA		
	L	43	LENGTH		
	SPL	10	NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 FB-18414	T	44	NO OF TEETH		Skoda:
	G	45	PINION DIA		
	L	43	LENGTH		
	SPL	10	NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		

 FB-18415	T	10	NO OF TEETH	2525287 1852716 1876857 1877355 1933471 1941157 1942950 1950058 1964127 1966931 1968355 1971707 1975046 4019393 10498623 D2024 D2025 D2042 C6TZ11350A 130538 4-310 54-137-2 54-113-1-SP 1.01.0093.0 DR-B10407	Clark: Empilhadeira c/ motor Detroit D478 e partida Delco Remy. General Motors: D478 c/ partida Delco de 69 a 72. For: Delco 10MT, 20MT, 22MT, 25MT, 27MT, 30MT, 35MT, SD300 Series DD Starters
	G	40	PINION DIA		
	L	96	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18416	T	10	NO OF TEETH	1893445 D2027 D2035 131429 4-348 54-106 1.01.0454.0 DR-5802 S5894	For: Delco 15GR Series OSGR; 20MT, 25MT, 27MT Series DD Starters Used On: (1989-78) Buick, Cadillac, Chevrolet, GMC, Oldsmobile, Pontiac General Motors
	G	32	PINION DIA		
	L	81	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18417	T	9	NO OF TEETH	10499849 1877346 1942597 1943307 1950057 1955959 1960178 54-107-9 4-296 1.01.0026.0	Hyster: Empilhadeira c/ partida Delco de 56 a 69. For: Delco 10MT, 20MT, SD300 Series DD Starters
	G	36.5	PINION DIA		
	L	96	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18418	T	9	NO OF TEETH	322	Skoda:
	G	25.8	PINION DIA		
	L	79	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		

 FB-18419	T	9	NO OF TEETH	9423227 94233227 2114-55004 2114-65001 31207634005 8942332270 8942332770 23300-H6000 23312-E6700 23312-H5000 23312-H5001 23312-H6700 23312-H6900 SD149 4-621 131085 54-8110 1.01.0349.0 HT-103 SDHI-2549	For: Hitachi DD Starters Used On: (1984-73) Honda, Isuzu, Nissan Unit Nos: Hitachi S108-63, S114-140, S114-141, S114-149S114-160, A, B, D, E, FS114-162, D S114-163, B, ES114-164, S114-211,S114-227, S114-271 Honda: ACCORD 1.6, CIVIC 1.2 - 1.5, CIVIC CVCC 1977 L4 1.5 GAS Nissan - Datsun: 210 LUXURY 1982 L4 1.5 GAS, 210 MPG 1982 L4 1.4 GAS. J15, SUNNY 120Y
	G	29.5	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18420	T	12	NO OF TEETH		
	G	36.5	PINION DIA		
	L	51.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.3	CLUTCH O/D		
	CW		ROTATION		

 FB-18421	T	10	NO OF TEETH	9002336237 6033AD0184 6033AD0200 6033AD4019 231756 233728 1.01.1159.0 54-42-90 52-42-94	Renault: TRUCKS 1983-2002 SEE: 120-6057, A, B (360, 368 SERIES VERSIONS), V.I. Midliner
	G	40	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18422	T	9	NO OF TEETH	9002336226 9002336227 136743 1.01.0861.0 BO-AHT93722 52-42-32 223965	Ford: F 1000 D (Maxion TN1) General Motors: PICK UP S 10 D Land Rover: DEFENDER 2.5 D
	G	36.8	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

 FB-18423	T	11	NO OF TEETH	1987BE0055 2250-25003 2250-25004 2250-45004 2250-85005 2250-95001 2270-8500 23133-99210 23312-T9000 23312-T9003 23314-Z9002 1-81123-0080 133058 54-8130 HT-207 1.01.0901.0 FD6 6BB1 6BD1	Nissan – Datsun: ED33, FD6, Fork Lifts
	G	40.5	PINION DIA		
	L	77	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	16	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18424	T	9	NO OF TEETH	10457362 10457368 10503933 1.01.0985.0	Fiat Allis: Fiat Allis Pá Carregadeira FR128 e Trator de Esteira 7D Mercedes: 915 c Accelo, Caminhão/Ônibus c/ motor OM904, OM906, OM924, OM926, eletrônicos c/ partida Delco Remy 28MT (09/17 ton.)Caminhões 712C, 715, 714C, 915C, 1215, 1218EL, 1218L, 1418 EL, 1418L, TCM EQUIPMENT Ag: Série 28MT 12/24V (MB - OM 904, 906, 924, 926 09 a 17 ton.)
	G	36	PINION DIA		
	L	85.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18425	T	20	NO OF TEETH	ME701487 ME701648 ME701651 M191X67571 M191X67585 M191X67771 M357X67871 M191X67885 M191X68271 M191X68671 M8T50071 M8T50171 M8T60071 139819 231371 4-1030 54-83415 1.01.0887.0 MT-N3 6D17	Ford: CARGO (7.3 L engine); E-F VANS Mitsubishi; CANTER Unit Nos: Mitsubishi M8T500 71, M8T50171, M8T60371, M8T60372, M8T60771
	G	14.7	PINION DIA		
	L	110	LENGTH		
	SPL	5	NO OF SPLIN		
	ID		BUSHING DIA		
	D	65	CLUTCH O/D		
	CW		ROTATION		

 FB-18426	T	9	NO OF TEETH		Skoda:
	G	29.6	PINION DIA		
	L	79	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	45	CLUTCH O/D		
	CCW		ROTATION		

 FB-18427	T	9	NO OF TEETH	9141460	Skoda:
	G	29.6	PINION DIA		
	L	79	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18428	T	9	NO OF TEETH	1006209533 136472	AUDI: 80 1.6 D
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18429	T	9	NO OF TEETH	1006209655 1006209760 234293 1.01.1480.0	Volkswagen: VW LT 28SDI, LT 35 SDI, LT 46 SDI
	G	25.8	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		
 FB-18430	T	9	NO OF TEETH	1006209637 137889 1.01.1109.0	Opel: Astra, Frontera, Saad 9.3, Vauxhall, Vectra, Zafira 2.0 DTL 16V
	G	25.8	PINION DIA		
	L	56	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	52	CLUTCH O/D		
	CW		ROTATION		
 FB-18431	T	8	NO OF TEETH	2114-45008 136144 54-8148 1.01.0757.0 SDHI-2419 6104-2419	YANMAR: GENERATORE GA220-340-L35-100
	G	28	PINION DIA		
	L	60	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	49	CLUTCH O/D		
	CCW		ROTATION		



FB-18432

T	9	NO OF TEETH	10452348
G	25.8	PINION DIA	10455504
L	47	LENGTH	10501804
SPL	6	NO OF SPLIN	8000045
ID	12	BUSHING DIA	8000058
D	45.6	CLUTCH O/D	89017523
CW		ROTATION	9000856
			9000868
			9000881
			9000896
			9000901
			9000933
			9000939
			9000977
			1.01.0952.1
			54-173-1
			SD1382
			ZEN10003

Buick: CENTURY 3.1L(189) V6 2001
Cadillac: ESCALADE 5.3L(325) V8 2004-2005
Chevrolet: AVALANCHE 5.3L(325) V8 2004-2005, EXPRESS VANS 5.3L(325) V8 2005, IMPALA 3.4L(207) V6 2001, LUMINA (SEDAN) 3.1L(189) V6 2001, MALIBU 3.1L(189) V6 2001, MONTE CARLO 3.4L(207) V6 2001, SILVERADO PICKUP 5.3L(325) V8 2005, SSR SPORT TRUCK 5.3L(325) V8 2003-2004, SUBURBAN 5.3L(325) V8 2004-2005, TAHOE 5.3L(325) V8 2005, TRAILBLAZER 5.3L(325) V8 2004-2005, VENTURE 3.4L(207) V6 2001
Fiat: Strada 1.8
General Motors: Astra 1.8 e 2.0, Blazer 2.2 e 2.4, Corsa 1.8, ENVOY 5.3L(325) V8 2004-2005, Meriva 1.8,
Isuzu: ASCENDER 5.3L(325) V8 2004
Oldsmobile: ALERO 3.4L(207) V6 2001, SILHOUETTE 3.4L(207) V6 2001
Pontiac: AZTEK 3.4L(207) V6 2001, MONTANA 3.4L(207) V6 2001
Saab: 9-7 5.3L(325) V8 2005
Saturn: 2004-01



FB-18433

T	9	NO OF TEETH	076980
G	25.8	PINION DIA	093623
L	60	LENGTH	097062
SPL	12	NO OF SPLIN	NE184
ID	12	BUSHING DIA	SD324
D	46	CLUTCH O/D	130759
CW		ROTATION	4-704
			54-9402
			PG-104
			1.01.0248.0

Renault: R 12, R 18, R 4, R 5, R 6

220-40017/06-46-77/9631
SDPA-2023/W472-06
61-20-24026/223224/3252
31/16488/16597/16755



FB-18434

T	11	NO OF TEETH	2006209465
G	35.8	PINION DIA	4-934
L	74	LENGTH	133596
SPL	10	NO OF SPLIN	54-9179
ID	14.3	BUSHING DIA	1.01.0764.0
D	60	CLUTCH O/D	208-252
CW		ROTATION	220-24062
			SDBO-2422
			61-15-6540
			42-42-88
			W470-90

KHD: F2 L1011 - F3 L1011 - F4 L1011



FB-18435

T	9	NO OF TEETH	SD1244
G	29.5	PINION DIA	
L	104	LENGTH	
SPL	5	NO OF SPLIN	
ID		BUSHING DIA	
D	53.8	CLUTCH O/D	
CW		ROTATION	

 FB-18436	T	9	NO OF TEETH	10484659 1.01.1112.0 54-182-1	TCM EQUIPMENT Ag: Motores 28MT 12/24V, Motores 28MT 24V For: Delco 28MT Series 24V OSGR Starters Used On: Freightliner, Blue Bird, Champion Buses
	G	36	PINION DIA		
	L	85.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18437	T	10	NO OF TEETH	10457121 4-364 137760 1.01.0722.0 54-8411 2820 220-12207 201-287 SDNK-2932 N47-08 61-01-3495	Case: Cummins: John Deere (SLC): For: Delco 28MT Series OSGR Starters Used On: Consolidated Diesel, Cummins, John Deere, Mack
	G	32	PINION DIA		
	L	85.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18438	T	12	NO OF TEETH	M191T63271 MT-24516B	
	G	46	PINION DIA		
	L	111	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17.2	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18439	T	11	NO OF TEETH	23313-99001	
	G	48	PINION DIA		
	L	90	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	19	BUSHING DIA		
	D	71	CLUTCH O/D		
	CW		ROTATION		
 FB-18440	T	9	NO OF TEETH	786-903S	
	G	35.8	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		
 FB-18441	T	11	NO OF TEETH	F002G20507	
	G	34.8	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	51	CLUTCH O/D		
	CCW		ROTATION		

 FB-18442	T	8	NO OF TEETH	26258003 1.01.1503.0	MUL: 800CC MPFI Mahindra: Champion M&M - 3 WHEELER, MUL F8B CAR,
	G	28.4	PINION DIA		
	L	71.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CCW		ROTATION		

 FB-18443	T	11	NO OF TEETH	26253237	SWARAJ MAZDA T 3500
	G	34.5	PINION DIA		
	L	92	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CCW		ROTATION		

 FB-18444	T	9	NO OF TEETH	1006209656 F002G20517 28100-0G010 233828 1.01.1155.0 52-42-98	Lombardini: 3 AND 4 CYL DIESEL 1989-ON Toyota: Avensis 2.0 TD, Corolla 2.0
	G	34.5	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		

 FB-18445	T	10	NO OF TEETH	26252662	FORD / SIMPSON
	G	40	PINION DIA		
	L	74	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18446	T	9	NO OF TEETH	1006209645 1006209802 1006209987 230828 54-91135-1 1.01.1033.0 6120-2056 52-42-36	Alfa Romeo: 156 1.9 JTD BMW: 324 TD touring, 325 TD, 325 TDS, 325 TDS touring, 525 TD, 525 TD touring,, 525 TDS, 525 TDS touring, 725 TDS Fiat: Brava/o 1.9 TD-JTD, Marea 1.9 TD-JTD, Multipla 1.9 JTD Opel: Omega 2.5 TD, Omega 2.5 XTD, Frontera 2.5 TD
	G	29.5	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		

 FB-18447	T	11	NO OF TEETH	8014250	
	G	40.5	PINION DIA		
	L	91	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14.6	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		