

 FB-18518	T	10	NO OF TEETH	66241322 LU-W1027 35-44-81	
	G	26.8	PINION DIA		
	L	48	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18519	T	8	NO OF TEETH	66242137	
	G	27.4	PINION DIA		
	L	65.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18520	T	9	NO OF TEETH	66242144	
	G	25.8	PINION DIA		
	L	56.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18521	T	12	NO OF TEETH	15452929 1.01.1082.0 54-176-3	Ford: F350 Heavy Duty modelos 98 em diante., F450 Heavy Duty modelos 98 em diante. Used On: Mexican Applications
	G	32	PINION DIA		
	L	47	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18522	T	8	NO OF TEETH	180205 182848 187788 190205 230205 300305 494829 594345 DB7E17 D7E15 NE971 139477 54-9437-1 1.01.0843.0 36-46-21	Renault: Clio 1.6, Kangoo 1.6, LAGUNA NEVADA 1.6, Megane 1.6,R11 1.6,. R12 1.6, R19 1.6, R9 1.6 / 1.7, Scenic 1.6
	G	23.8	PINION DIA		
	L	44	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		

 FB-18523	T	9	NO OF TEETH	060527 080327 100327 187336 187863 187996 188251 220527 250527 260412 270327 290212 494828 494832 594287 NE949 139473 1.01.0965.0 36-46-16	Citroën: C 3 Fiat: 147 1.1 e 1.3 1973/1986, Duna 60, 70 e Weekend 1986/1990, Elba 1.0, 1.3, 1.5 SOHC 1985, Fiorino 1.0, 1.3, 1.5 1985, Oggi 1.1, 1.3 1973/1986, Palio 1.0 8v e 16v, 1.3 16v, 1.5 EL Mpi e ELX Mpi, 1.8 Ford: Courier 1.0L / 1.6L Zetec Rocam, EcoSport 1.0L / 1.6L Zetec Rocam, EcoSport 1.0L Supercharger, Escort 1.6L Zetec Rocam, Fiesta 1.0L / 1.6L / Zetec Rocam ano 99, Ka 1.0L / 1.6L Zetec Rocam, Novo Fiesta 1.0L Supercharger Peugeot: 106, 206 1.0 16V / 1.4 / 1.6 / 1.6 16V Renault: Clio 1.0 / 1.0 16V / 1.6 16V, KANGOO 1.0 / 1.0 16V / 1.2 / 1.6 16V, TWINGO 1.0 / 1.2
	G	25.8	PINION DIA		
	L	41	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		

 FB-18524	T	8	NO OF TEETH	93297293 090800 188440 190993 494830 594436 234231 1.01.1064.0 SS260300	General Motors: Celta 1.0 Renault: Scenic 2.0 16V 2003
	G	23.8	PINION DIA		
	L	41	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		

 FB-18525	T	9	NO OF TEETH	2108-F3500 2108-75002 S108-28H S108-28K S108-61F S108-61G S108-116 136208 4-752 54-8106 1.01.0536.1 1.01.1191.0	Hitachi: S108-116, S108-61, (A, B, C, D, E, F, G). Kawasaki: SX440, SX550, 21163-3003 (F, G, YR), 21163-3710, 21163-3711, 21163-5031 ZEN: Impulsor para Jet Ski Kawasaki 21163-3710 59051-3005/18305 220-44022/SDHI-2533 W475-70/61-25-14139
	G	30	PINION DIA		
	L	40	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18526	T	8	NO OF TEETH	23312-36A00 2114-65509 S114-440, S114-475A, S114-486 137752 1.01.0793.0 54-8138 HT-S0828A 16816 17178 SDHI-2600 W475-107 61-25-14047	Nissan – Datsun: E16, NX 1600, NX 2000, Pulsar 1.6, Sentra 1.6 For: Hitachi OSGR Starters Used On: (1992-85) Nissan Replaces: Hitachi 2114-65509 Unit Nos: Hitachi
	G	28	PINION DIA		
	L	94	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.2	CLUTCH O/D		
	CCW		ROTATION		

 FB-18527	T	9	NO OF TEETH	2130-8502 2130-35008 230556 129900-77510	HITACHI: S13-204 YANMAR: 129900-77010 LESTER: 18491 WOODAUTO: STR6016 12V 2.3KW 9T KOMATSU Forklift
	G	36	PINION DIA		
	L	100	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.2	CLUTCH O/D		
	CW		ROTATION		
 FB-18528	T	9	NO OF TEETH	1006209636 1006209643 1006209759 047911335G 137890 1.01.0972.0 224072 52-42-52	Ford: GALAXY 2.8 Seat: CORDOBA 1.9 D/TD, IBIZA 1.9 D, INCA 1.9 D, Seat. Volkswagen: GOLF 2.8, PASSAT 1.9 TDI, POLO 1.9 D, SHARAN 2.8 V6, VENTO 1.9 TDI, VW
	G	25.7	PINION DIA		
	L	90	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	53	CLUTCH O/D		
	CCW		ROTATION		
 FB-18529	T	12	NO OF TEETH	10457141 231963 4-363 54-8410 1.01.0723.0 6591 220-12226 SDNK-2933/N 47-02 61-01-3497	For: Delco 28MT Series OSGR Starters Used On: Lister-Petter, Perkins
	G	46.3	PINION DIA		
	L	85	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18530	T	9	NO OF TEETH	1.01.1552.0	Ford: ME-1552/214653-532 290507
	G	25.8	PINION DIA		
	L	47	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18531	T	11	NO OF TEETH	1.01.1553.0 ME-1553 140507 22172-382	Ford:
	G	29.5	PINION DIA		
	L	47	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18532	T	11	NO OF TEETH	EM-14	Ford:
	G	30	PINION DIA		
	L	67	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18533	T	10	NO OF TEETH	35259873 35260967 1.01.1090.0 K229.873	Ford: F 350 with Cummins B engine Aftercooler 3.9 c/ conec. Estanco, F 4000 with Cummins B engine Aftercooler 3.9 c/ conec. Estanco John Deere (SLC): Trator 5600 Volkswagen: Caminh VW 13180 – MWM, Caminh 17210 com partida Lucas
	G	32	PINION DIA		
	L	80	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18534	T	10	NO OF TEETH	1.01.1575.0 EM-1575	Ford:
	G	33	PINION DIA		
	L	44.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18535	T	9	NO OF TEETH	4239117 74879621 130752 01-41-76	FIAT: POLSKI:MARELLI 125
	G	30	PINION DIA		
	L	67	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	53	CLUTCH O/D		
	CW		ROTATION		
 FB-18536	T	15	NO OF TEETH	2130-55005 2130-6500 2130-65002 4-925 54-8146 133266 1.01.0785.0	Yanmar: TRACTORS For: Hitachi OSGR Starters Used On: John Deere Unit Nos: Hitachi S13-41A X-2130550050/X-2130650 020/59-70-58/220-44038 61-25-14160/6104-2381
	G	44.5	PINION DIA		
	L	70	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18537/19145	T	11	NO OF TEETH	188595 594382 234086	RENAULT: CLIO - LAGUNA - MEGANE - SCENIC VALEO
	G	30	PINION DIA		
	L	51	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18538	T	10	NO OF TEETH	10457122 4-361 54-8408 231965 1.01.0721.0	For: Delco 28MT Series OSGR Starters Used On: Detroit Diesel, Lister-Petter 6594/6597 220-12224 SDNK-2931 51-01-3496
	G	40	PINION DIA		
	L	85.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18539	T	10	NO OF TEETH	10457178 4-362 54-8409 231964 1.01.0645.0	Lincoln Teledyne For: Delco 28MT Series OSGR Starters Used On: Lincoln Electric, TCM 220-12225/ SDNK-2930 61-01-3494
	G	32	PINION DIA		
	L	85	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	13	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18540	T	10	NO OF TEETH	54246724 54246989 54256984 54259800 TMB104 130450 4-483 54-9205 1.01.0322.0	Ford: 2000 - 3000 - 4000 - 5000 – 7000 For: Lucas M45G, M50 Series Starters 25-44-45 61-17-8444
	G	40	PINION DIA		
	L	70	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18541	T	11	NO OF TEETH	10476528 4-491 54-154 231968 1.01.0870.1 1.01.1210.0	For: Delco 41MT Series DD Starters Unit Nos: Delco 10478897, 10478898, 10479023, 10479024, 10479043, 10479079, 10479165 General Motors: 6631/6635/221-497/220-12 263/61-08-4731/D47-39
	G	57	PINION DIA		
	L	102	LENGTH		
	SPL	19	NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D	58	CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18542	T	9	NO OF TEETH	2114-28100 2114-35551 23312-12G02 23361-42L60 011902829 SD623 136228 4-906 54-8135 1.01.0687.0 HT-116	For: Hitachi PMGR Starters Used On: (1995-86) Nissan Replaces: Ref. No. 0687 Unit Nos: Hitachi S114-503A S114-516, A S114-528, A Nissan – Datsun: PICK UP, TERRANO 3.0, VG30 16817/17196/220-44016 61-25-14138/W475-57
	G	29.5	PINION DIA		
	L	78	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		

 FB-18543	T	19	NO OF TEETH	36139-42000 237115 231269 1.01.1577.0 26100-42010 36100-42011 MG120413 2381 6113	HINDUSTAN MOTORS: LANCER VII 2.0 D HYUNDAI: GALLOPER I - II 2.5 TD H-1 - H100 2.5 CRDi - TD - 2.6 TDiC MIGHTY 2.5 D PORTER Pick-up - 2.5 TD STAREX 2.5 TD - 4WD MITSUBISHI MOTOR: GALANT II 2.3 Turbo-D - GALANT V 2.0 GLS TD L 200 - L300 2.3 - 2.5 D - 4X4 LANCER IV - V 2.0 D PAJERO I - II 2.5 TD SPACE WAGON 1.8 TD PROTON: PERSONA 400 2.0 D
	G	14.7	PINION DIA		
	L	117/131	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	65	CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18544/19174	T	11	NO OF TEETH	028300-8011 28011-23440 233641	SD-5087/22800-5430
	G	40	PINION DIA		
	L	146	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	57	CLUTCH O/D		
	CW		ROTATION		

 FB-18545	T	8	NO OF TEETH	1.01.1532.0	Nissan – Datsun: Tsuru
	G	28	PINION DIA		
	L	61	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	49	CLUTCH O/D		
	CCW		ROTATION		
 FB-18546	T	9	NO OF TEETH	080827 110427 494833 D7E33 D7E45 1.01.1533.0	Renault: Ford: Courier, Ecosport, Fiesta, Focus, Ka 6S6519000AA
	G	24.5	PINION DIA		
	L	41	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18547	T	9	NO OF TEETH	1006209641 1006209762 1006209781 F000AL1186 F000AL1681 047911335J 138875 1.01.1080.1 1.01.1223.0	Renault: 52-42-53
	G	25.8	PINION DIA		
	L	80.5	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		
 FB-18548	T	11	NO OF TEETH	489324722 M191T35271 M191T31071 4-745 131628 54-8300 1.01.0426.0	Hyster: FORK LIFTS Mazda For: Mitsubishi DD Starters Used On: Hyster, TCM, Yale Lift Trucks w/ Mazda Engine 49-71-46/16795/223644
	G	34.8	PINION DIA		
	L	61	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12.8	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18549	T	9	NO OF TEETH	2006209434 231885 4-974 54-9183 1.01.0784.0	Case: Fiat: For: Bosch 367 Series DD Starters 17308/223908 220-24085/SDBO-2322 WW470-100
	G	29.7	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CCW		ROTATION		
 FB-18550	T	10	NO OF TEETH	M191T19071 1.01.1538.0 54-8341-1	For: MitsubishiPMGR Starters Used On: (2002) Jeep UnitNos: Chrysler56041641A C,Mitsubishi M1T86883 Lester Nos: 17877 Chrysler: Jeep Liberty 2.4L e 3.7L, a partir de 2001 Mitsubishi: Mitsubishi-M1T86781ZC-2.4L (2002) Mitsubishi - M1T86883ZC - 3.7L (2002) Mitsubishi - M1T86782ZC -2.4L(2003) Mitsubishi-M1T86884ZC-3.7L (2003) Mitsubishi - M0T91981ZC - 2.4L (2004/05) Mitsubishi - M0T92081ZC - 3.7L (2004)
	G	33	PINION DIA		
	L	64	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18551	T	10	NO OF TEETH	26241150	PIAGGIO-3 WHELLER
	G	27.8	PINION DIA		
	L	92.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CCW		ROTATION		
 FB-18552	T	9	NO OF TEETH	1006209436 4-857 131489 54-9146 1.01.0417.0 16787 W470-52 61-15-6484 42-42-26	Bomag: BW 905 SH/SL Mercedes: 0302-0352 OTOBUS For: Bosch 314 Series DD Starters Used On: Deutz, KHD
	G	34.8	PINION DIA		
	L	64	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18553	T	9	NO OF TEETH	F000AL1306 F000AL1694 1.01.1177.0	F000AL0400
	G	25.8	PINION DIA		
	L	90	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CW		ROTATION		
 FB-18554	T	9	NO OF TEETH	9000862 9927793 9929081 9935731 9936772 9959707 9986112 72138901 72139001 72139007 72363401 72363402 72397101 72397106 79023774 SD125 SD128 4-626 131109 54-9300-1 1.01.0407.0	Alfa Romeo: 30 - 32 - 35 - 40 (AR 8) Fiat: 131 D - 132 D, ARGENTA D, DUCATO D Fiat Allis: 355 - 450 - 480 - 500 - 550 - 580, 670 - 780 - 850 - 880 - 1000 - 1300, FL 4C - TL 5 Fiat Iveco: DAILY 28.8 - 30.8 - 32.8 - 35.8 OM: GRINTA 28.8 - 30.8 - 32.8 - 35.8 Simit: S 60 For: Marelli 12V / 2.5kW, 3.5kW; 24V / 4.0kW DD Starters Used On: Fiatallis, Oliver, White Replaces: Ref. No. 0407 Unit Nos: Marelli 63216727, 63216740, 63216808, 63216825, 63216826, 63216827, 63216873, 63216898, 63217104, 63217118, 63217119, 63217120, 63217125, 63217147
	G	34.8	PINION DIA		
	L	77.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18555	T	13	NO OF TEETH	54247397	Case: 580 - 990 - 995 - 1294 - 1394 Dodge: FB BANTAM - DKC - KC - KCB Lancer: HP Series Massey Ferguson: MF 101 C, MF 275, 285, 365, 375, 399 For: Lucas M45G Series DD Starters Used On: Massey Ferguson, Perkins
	G	46	PINION DIA	60600078	
	L	73	LENGTH	TMB125	
	SPL	12	NO OF SPLIN	4-671	
	ID	17	BUSHING DIA	131729	
	D	60	CLUTCH O/D	54-9218	
	CW		ROTATION	1.01.0134.0	
				61-17-8429 25-44-33 17642	

 FB-18556	T	9	NO OF TEETH	85541270	Alfa Romeo: 145, 146, 147, 155 e 156 BMW: Fiat: BARCETTA, BRAVA, BRAVO, COUP?, MARE A, PUNTO II, STILO Lancia: DELTA, KAPPA, L YBRA
	G	29	PINION DIA	1.01.1113.0	
	L	50.5	LENGTH	138793	
	SPL	10	NO OF SPLIN	2027	
	ID	12	BUSHING DIA	21-41-36	
	D	48.7	CLUTCH O/D		
	CW		ROTATION		

 FB-18557	T	10	NO OF TEETH	G537	
	G	32.7	PINION DIA		
	L	96	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.2	CLUTCH O/D		
	CW		ROTATION		

 FB-18558	T	12	NO OF TEETH	F8RU88D004	Mazda: Mazda B-2000
	G	38	PINION DIA	1.01.1646.0	
	L	47	LENGTH		
	SPL	12	NO OF SPLIN	E58-0270-Z	
	ID	12	BUSHING DIA	FM:74221	
	D	45.5	CLUTCH O/D	15221	
	CW		ROTATION		

 FB-18559	T	12	NO OF TEETH	C8TZ11350B	Caterpillar: D330C, D333C, D334C, D336C, D344C General Motors: 851073/852762/852961 6N-3827/480118/480411 04489/77601/223111 801016V/480411/486039 221489/220-12251 /61-08-47
	G	46.3	PINION DIA	C8TZ11350D	
	L	120	LENGTH	C9WF11350C	
	SPL	19	NO OF SPLIN	D4HF11350AA	
	ID	15.9	BUSHING DIA	1114087	
	D	57.5	CLUTCH O/D	1893560	
	CW		ROTATION	1894213	
				1936647	
				1946945	
				1946957	
				1957846	
				1970711	
				8000068	
				4-489	
				131056	
				1.01.0097.0	
				54-124-2	

 FB-18560	T	10	NO OF TEETH	26245621	BOLERO - SLE&SLX - MDI 3.2 Ltrs DIESEL ENGINE-SCORPIO CHAIN DRIVE
	G	39.4	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18561	T	12	NO OF TEETH	1985262 54-132-1-R D54-338P	For: Delco 37MT Series DD Starters Case: Caterpillar: Clark Cummins: Cummins c/ partida Delco Remy 37MT 12/24V 12D (Caminhões GMC, MB, VW). IHC: Lister: Perkins: Waukesha Delco Remy: Série 37MT 12/24V (MB, VW, Ford, GMC, Cummins, Caterpillar General Motors: Caminhões c/ motor Caterpillar e parti
	G	46.5	PINION DIA		
	L	97.8	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	58.4	CLUTCH O/D		
	CW		ROTATION		
 FB-18562	T	11	NO OF TEETH	奇特	
	G	40.5	PINION DIA		
	L	77.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	16	BUSHING DIA		
	D	63	CLUTCH O/D		
	CW		ROTATION		
 FB-18563	T	9	NO OF TEETH	6033AD1062 233947 1.01.1483.0 54-42-89 288356 0001223016 0001223021 11.131.949 LESTER18951	Fiat Iveco: IVECO BF4L1011 (2.7L - 2732cc) 1995, IVECO BF4L1011 (2.71L - 2732cc) 2001, IVECO F2L1011 (1.4L - 1366cc) 1997, IVECO F2L1011 (1.4L - 1366cc) 2002, IVECO F4L1011 (2.7L - 2732cc) 1999
	G	34.7	PINION DIA		
	L	63	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	58	CLUTCH O/D		
	CW		ROTATION		
 FB-18564	T	9	NO OF TEETH	10500475 54-175 1.01.1482.0	For: Delco PG260D Series PMGR Starters Used On: (2005-03) Nissan TCM EQUIPMENT Ag: ECOSPORT Delco 9000908, Hitachi S114-900, Nissan 23300-8U300
	G	29.5	PINION DIA		
	L	47	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18565	T	9	NO OF TEETH	106191 191601 236797 330692 AS-SD3028 2377 36-46-28 72644	FIAT: 500 - PANDA - 4X4 1.3 MJ, DOBLO' 1.3 - 1.9 JTD MJ, GRANDE PUNTO - IDEA - PUNTO 1.3 MJ LANCIA: YPSILON - MUSA 1.3 - 1.9 JTD MJ
	G	25.8	PINION DIA		
	L	45.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

FB-18566	T	11	NO OF TEETH	TT	
	G	53.2	PINION DIA		
	L	133.5	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		

 FB-18567	T	41	NO OF TEETH	2114-25509 23354-16E01 135059 4-1092 54-81401 1.01.0793.1 1.01.1207.0 222-44010 105-70-08 SDHI-2545CL	Nissan – Datsun: NX 1600, NX 2000, Pulsar 1.6, Sentra 1.6, Hitachi S114-430A, B; S114-439, A; S114-440; S114-441A, B; S114-461, S114-475A, S114-484, S114-486, Hitachi OSGR Starters, (1992-85) Infiniti, Nissan W475-130/61-25-14082
	G	53.2	PINION DIA		
	L	50	LENGTH		
	SPL	10	NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		

 FB-18568	T	9	NO OF TEETH	31204-PAA-A0 2 54-8503	For: Mitsuba PMGR Starters Used On: (2002-98) Acura, Honda 31200-PAA-A02, Isuzu 5-86206-168-0, Mitsuba SM442-02 Lester Nos: 17729 WAI Ref. Nos: 2-1940-MT
	G	29.7	PINION DIA		
	L	95	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	61.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18569	T	9	NO OF TEETH	31204P2A004 31204P2C004 54-8502 1.01.1548.0 CSD-6046	For: Mitsuba PMGR Starters Used On: (2005-96) Acura, Honda Unit Nos: Mitsuba SM422-07, -08, -09, -10, -19; SM442-08, -09, -10, -32 Lester Nos: 17474, 17587, 17675, 17693, 17721, 17741, 17742, 17847
	G	29.7	PINION DIA		
	L	95	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	63	CLUTCH O/D		
	CW		ROTATION		

 FB-18570	T	10	NO OF TEETH	2006209498 2006209533 2006209539 2006209932 131475 1.01.0538.0	Man : 10.136 - 12.136 - 12.170 - 12.192, 14.136 - 14.170 - 14.192 - 16.136 SDBO-2482 61-15-6529 6120-2482 42-42-58
	G	38	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18571	T	11	NO OF TEETH		12V, CCW, 3.0kw, 11 Teeth Gear Size: 40mm Gear OD For: NPR, NQR Series Lester: 18500 PIC: 190-6061 OE: 228000-818 Note: CHEV W3500, 4500, 5500 TRUCKS 1999-01 ISUZU TRUCKS 2001-99 NOTE: ISUZU 3.9L, 4.8L DIESEL ENGINES SEE: 190-6054 (1998 MODEL TRUCKS)
	G	40	PINION DIA		
	L	146	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	57	CLUTCH O/D		
	CCW		ROTATION		

 FB-18572	T	9	NO OF TEETH	16.900.922 1.01.0926.0 133860 54-9503 49-52-90 16900922	RENAULT: ISKRA R18,R20,R4 GTL,R5TRAFIC VOLKSWAGEN: ISKRA,GOL F,JETTA,POLO VOLVO: ISKRA,343-345 11.130.193/244/291/590
	G	25.8	PINION DIA		
	L	56.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18573	T	9	NO OF TEETH	9001336223 SD427 130732 1.01.0451.0 09-51-99 1706115 17061-15	Daf: 55,66 Renault: R 4, R 4 F6, R 5, R 6 Seat: 127 Talbot: 1100 - 1200
	G	25.8	PINION DIA		
	L	62	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18574	T	9	NO OF TEETH	106140 183917 583289 583336 NE307 NE308 NE603 SD047 SD499 TMB265 132181 4-690 54-9400 1.01.0574.0 PG-P102	Citroën: AX 10 - 11 - 14, BX 16 Peugeot: 205, 205 GTI, 305, 405 Renault: FUEGO, R 11, R 18, R 9, SUPER 5 220-40000 327585 331025 331032 583277 583347 683145
	G	25.8	PINION DIA		
	L	53	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18575	T	10	NO OF TEETH	45-6032	Application: CHEVROLET V8 Lucas: LRS1664 MITSUBISHI: S114823-M1T-9T 12V 1.4KW 10T CW CHEVROLET V6 V8 HITACHI S114-823S HITACHI PSL100 LESTER 19695 WAI 2-2982-HI
	G	27.8	PINION DIA		
	L	66	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		
 FB-18576	T	9	NO OF TEETH	2006209458 2006209543 2006209544 136509 1.01.0970.0 54-9199-1 42-42-93 6120-3108	Case: BACKHOE Excavator 1088, Tractor Series 5100 1987-92 Daf: 45. 130
	G	36.5	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18577	T	10	NO OF TEETH	191363 1.01.1618.0	Renault : Master 2005 Eletrônico DCi120. 8200225336 D7G11
	G	32	PINION DIA		
	L	45.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18578	T	11	NO OF TEETH	180827 184530 182176 185675 186456 594042 NE776 NE832 133897 1.01.0961.0 1.01.0936.0	Mercedes: 190 D - 200 D - 300 D - E 200, 250, 300 TD Peugeot: 504 2.1 / 2.3 diesel, 505 1.6 / 1.8 / 2.0 / 2.3 D, 604 D, J9 D Renault: EXPRESS D, R 19 D, SUPER 5 D Ssangyong: MUSSO 2.9 D VALEO
	G	29.5	PINION DIA		
	L	61	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18579	T	9	NO OF TEETH	681378 SD194 NE324 4-686A 130424 1.01.0245.0 54-9418-1 PG-103A	Renault: R 4, R 5, R 6, Rodeo SDDU-2258/220-40002 289862 302613 060846 223505
	G	25.8	PINION DIA		
	L	59.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18580	T	9	NO OF TEETH	079801 093511 095304 NE170 131173 PG-147A 325229 SDPA-2014	PEUGEOT: 305 TALBOT: 1000 RALLYE - 1007 SR RALLYE VOLKSWAGEN: 1200 - 1300 - 1302 - 1303 D8E112 D8E120 D8E123 D8E144 D8E158
	G	25.8	PINION DIA		
	L	67	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18581	T	13	NO OF TEETH	M191T19271 234514 MT-108H-335 59-71-80 34-32115	MITSUBISHI: BERLINGO 2.0HDI, CITROEN C5, JUMPER
	G	35	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		
 FB-18582	T	9	NO OF TEETH	FO1094 FO1904 C4TF11350A C4TF11350AZ C4TF11350Z C4TZ11350 C4TZ11350A C4TZ11350B C8TF11350A D6TF11350AA SD-153 SD-168 4-236	13-530 480091 480205 480475 B7TZ11002B C4TF11001A C7TF11000A ND236
	G	29.5	PINION DIA		
	L	71.5	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		
 FB-18583	T	9	NO OF TEETH	102846 NE201 132176 PG-131A	PEUGEOT: 305-305XL D9E97 D9E98 583564 26-46-46 VALEO
	G	25.8	PINION DIA		
	L	60	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CCW		ROTATION		



FB-18584

MX Z 500SS TRAIL 2004 2005 494CC, MX Z 550 FAN 2004 2005 494CC, MX Z 600 ADRENALINE HO 2004 2005 594CC, MX Z 600 ADRENALINE HO SDI 2005 594CC, MX Z 600 RENEGADE HO 2004 2005 594CC, MX Z 600 RENEGADE HO SDI 2005 594CC, MX Z 600 RENEGADE X 2004 2005 594CC, MX Z TRAIL HO 2004 2005 597CC, MX Z 600 X 2004 2006 594CC, MX Z 800 ADRENALINE HO & X 2004 2005 799CC, SKANDIC SUV 600 2004 2005 597CC, SANDIC WIDE TRACK 600 2004 2005 597cc, SUMMIT 800 HO 2005 799cc

T	8	NO OF TEETH
G	27.3	PINION DIA
L	33.5	LENGTH
SPL	6	NO OF SPLIN
ID	12	BUSHING DIA
D	47.5	CLUTCH O/D
CW		ROTATION

12-Volt
Replaces:
Denso:
428000-1101,
428000-3530
Ski-Doo:
515-175-562,
515-175-843,
515-176-003,
515-176-133
SKI DOO
BOMBARDIER
SNOWMOBILE
2002 2003 2004
2005 2006
515-176-003
515-176-133
515-175-562
515-175-843

Fits: Ski-Doo Snowmobile
2002-2006, 494cc, 503cc, 597cc, 698cc, 796cc, 799cc, 1004cc Engines
Product #:18875/18878
Description: Starter SKI DOO /BOMBARDIER
SNOWMOBILE 2002 2006
SKI DOO / BOMBARDIER
SNOWMOBILE
SKI DOO / BOMBARDIER
SNOWMOBILE:
EXPIDITION 600 HO SDI
2005 2006 597 CC,GSF
500F 2005 494 CC,GSF 600
HO 2004 2005 597 CC,GSF
600 HO SDI 2004 2005 597
CC,GSX 800 HO 2004 2005
796CC,GTX 500F 2005
494CC,GTX 600 HO 2005
597CC.GTX 600 HO SDI
2005 597CC,GTX 800 HO
2005 796CC,LEGEND 500
SS 2004 494CC,LEGEND
600 HO SDI 2004 494CC,
LEGEND 700 2004 698CC,
LEGEND 800 SDI 2004
796CC,MX Z 500SS
ADRENALINE 2004 2005
494CC,



FB-18585

T	13	NO OF TEETH
G	55.5	PINION DIA
L	106	LENGTH
SPL	10	NO OF SPLIN
ID	17	BUSHING DIA
D	72	CLUTCH O/D
CW		ROTATION

M191T72571
ME700176
MT-35500

ASD-22
PMT-72571

Particulars: PMT-72571 ;
DRIVE 8DC9 13T NO
BUSH ; MITSUBISHI ; 13T
Unit Reference Number:
3126650073, M005T50072,
M005T50073, M005T50081,
M005T50082, M005T50087,
M005T50088, ME067670,
ME067671, ME067672,
ME067675, ME067678,
ME067679



FB-18586

T	10	NO OF TEETH
G	40	PINION DIA
L	97.8	LENGTH
SPL	3	NO OF SPLIN
ID	14.3	BUSHING DIA
D	58	CLUTCH O/D
CW		ROTATION

1986244
54-131-1-R

D54-337P

FOR: Delco 37MT Series DD
Starters
Unit Nos: Delco 1990308,
309, 311, 312, 315, 318, 326,
347, 499; 1993701, 702, 705,
712, 723, 726, 738, 741, 744,
754, 756, 759, 761, 762, 767,
769, 789, 790, 792, 793, 799,
800, 817, 818, 819, 829, 837,
850, 854, 855, 862, 866, 879,
880, 881, 886, 893, 894, 903,
905, 914, 917, 921, 947, 950,
951, 954, 955, 956, 957, 963,
970, 971, 981, 986, 988, 994;
10478806, 814, 819, 831,
890, 921, 928, 929, 930, 953,
957, 976; 10479015, 016,
020, 035, 036, 054, 068, 069,
169, 170, 186, 195

 FB-18587	T	12	NO OF TEETH	1875852 1877353 1932890 1951180 10498438 D2026 D2043 130540 4-282 54-112-1-SP 54-112-D 1.01.0566.0	For: Delco 10MT, 20MT, 22MT, 25MT, 27MT, 30MT, 35MT, SD300 Series DD Starters D54482/221-482 220-12244 D47-44 60-08-4708/54-139-9
	G	46	PINION DIA		
	L	97	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18588	T	9	NO OF TEETH	54-4149-P	
	G	29.5	PINION DIA		
	L	76.5	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18589	T	10	NO OF TEETH	028300-1280 028300-1660 132634 4-682A 54-8200 1.01.0434.0 ND-209	John Deere (SLC): TRACTOR FOR: Nippondenso 2.5kW, 4.0kW DD Starters Used On: Case, Caterpillar, Hino, John Deere 02683662/02698850 A47788/4N7523 AR54992/SDND-2050
	G	40	PINION DIA		
	L	102	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18590	T	13	NO OF TEETH	1006209622 230350 1.01.1487.0	BMW: 318 TDS 0001110110
	G	40	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18591	T	9	NO OF TEETH	1006209575 54-9166	PORSCHE: 944-968 0001110060/0001110080 54-42-17
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18592	T	8	NO OF TEETH	2114-65004 2114-95002 23312-M1500 23312-M1501 131086 1.01.0382.0 54-8114 HT-104	Nissan – Datsun: CHERRY 120A, 310 GX 1980 L4 1.4 GAS, 310 GX 1981 L4 1.5 GAS 207-405 220-44004 16579
	G	28	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	45.7	CLUTCH O/D		
	CW		ROTATION		

 FB-18593	T	10	NO OF TEETH	1006209574 1006209626 1006209927 137170 54-9174 BO-7082RPA	PORSCHE: 911 3.3 TURBO, 911 3.8 CARRERA RS 0001110059 0001110073 0001110081/ CS888
	G	27.8	PINION DIA		
	L	109	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CW		ROTATION		

 FB-18594	T	11	NO OF TEETH	F000AL1693 9001081042 TMB042 1.01.0855.0 223305	Fiat : Palio Weekend 1.6 16V, Palio 1.6 16V, Tempra 2.0 MPI 16V, Tempra 2.0 SPI 8V, Tempra 2.0 Turbo MPI 8V, Tempra 2.0 8V, Uno.
	G	29.5	PINION DIA		
	L	55.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18595	T	21	NO OF TEETH	28011-8Y002	Applicable: DRIVER ASSY CAMRY '98-2002 丰田凯美瑞
	G	17.4	PINION DIA		
	L	102.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18596	T	9	NO OF TEETH		
	G	29.7	PINION DIA		
	L	45	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		

 FB-18597	T	11	NO OF TEETH	72336117 1.01.1161.0	Peugeot: J9D (Karsan). 32159-C/59-56-24
	G	29.7	PINION DIA		
	L	77.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18597A	T	11	NO OF TEETH	32159-C 1.01.1161.0 Magneti-Marelli 72336117 59-56-24	Peugeot: J9D (Karsan).
	G	29.7	PINION DIA		
	L	77.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18598	T	9	NO OF TEETH	1006209821 F000AL0111 F000AL1281 F000AL2281 1.01.1562.0	Toyota: Hilux2.5 / 2.8 2006 190.539.102/18353 /28100-0L080/F004A94008/F004A94011
	G	34.7	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18599	T	9	NO OF TEETH	66242193	
	G	25.8	PINION DIA		
	L	65	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CCW		ROTATION		
 FB-18600	T	8	NO OF TEETH	DR-E82825A 1.01.1605.0 ESP-281	Caterpillar: Blue Bird USA Cat 3126 7.2 International: Navistar DT 444E - V8 7.3 John Deere (SLC): Tractor 4045 4cil. 4.5 Gradall , 1550/608 1H 6cil. 7820/608 1H 6cil. Kia: Pop Pride, Pop Pride com Arranque Remy Cor
	G	28.4	PINION DIA		
	L	45	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	43.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18601	T	9	NO OF TEETH	54243957 54246242 54247078 54268335 TNB136 TNB141 131191 1.01.0283.1 LU-U0925 25-44-01 25-44-58	FORD(GB): CORTINA 2.3 - SIERRA V6 OPEL: MANTA A - MANTA B RELIANT: TW9C TRIUMPH: DOLOMITE 1500 VAUXHALL: CARLTON - CAVALIER 2838/25213A/K 25214A/J 25262A/D//25268A/B 25282A/J 25292A/D 60925019 60925020
	G	25.8	PINION DIA		
	L	69	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		
 FB-18602	T	10	NO OF TEETH	54245568 54246123 54247295 54268554 TNB153 134065 1.01.410.1 LU-U1027	FORD(GB): CAPRI - CAPRI II - CONSUL - CORTINA, ESCORT - GRANADA - SIERRA - TRANSIT MORGAN: 4/4 RELIANT: SCIMITAR - TW9B - TW9C - TW9E 25204A/L 25205A/L 25206A/T//25210A/D 25249A/F 25250A/J 25270A/K 25271A/F 25272A/H/25288A/H 25289A/J 25311A/F 25368A 25400A /SDLU-2579/25-44-69
	G	26.8	PINION DIA		
	L	69	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		
 FB-18603	T	11	NO OF TEETH	1006209555 4-1044 139336 54-9181 1.01.0781.0	Farymannl : ENGINES - MARINE 36A 0.6L Diesel, ENGINES - MARINE 36E 0.6L Diesel , ENGINES - MARINE 41A 0.7L Diesel, ENGINES - MARINE 41E 0.7L Diesel, 36 - 40 Series 18255 0001317024/1926/61-15-65 65/W470-105/SDBO-2133
	G	29.5	PINION DIA		
	L	64	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		

 FB-18604	T	9	NO OF TEETH	1006209421 130398 1.01.0484.0 2920 SDBO-2518 6120-2518 32-42-00	CHRYSLER ESPANA : SIMCA 1200 – 1500 MATRA : BAGHEERA – MURENA, RANCH TALBOT : 1100 - 1307 - 1308 - HORIZON - SOLARA 0001208203/0001208205/00 01208210/0001208214/0001208406
	G	25.8	PINION DIA		
	L	71	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18605	T	9	NO OF TEETH	1006209542 1006209550 135164 232481 54-91100-9 1.01.1065.0 1830/1720 52-42-20 42-42-99	Agrale: Goldoni: TRANSCAR 23 Lamborghini: 10 LD 400.2 Mosa: GE 1000 - TS 300,GE9000 Ruggerini: MD 95.0 - 95 S - 95.1,MM 150 - 190 - MW 150 - 151 - 190 – 191, RD 210 - RD 211 - RD 218 V.M.: DM 188 000117058/0001108050/000119028/0001110018
	G	29.7	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18606	T	10	NO OF TEETH	GM 88969483 Toyota 28100-0D080 028300-9541 54-8247	For: Nippondenso PMGR Starters Used On: (2006-03) Pontiac, Toyota 17841/2-2360-ND Denso 428000-0340
	G	32	PINION DIA		
	L	42	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18607	T	9	NO OF TEETH	1006209653 1006209751 1006209947 233720 62-42-03	VOLVO: 850 2.5 TDI - XC 70 2.5 D5,S60 - 70 - 80 2.4 D - D5 - 2.5 TDI FIAT: DOBLO" - PALIO - PUNTO - VAN 1.9 D, STRADA 1.9 D 0001109041/0001109048/ 0001109252/0001109256
	G	25.8	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		
 FB-18608	T	13	NO OF TEETH	1006209659 233839 2191	CHRYSLER: 0001107064
	G	34.6	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18609	T	10	NO OF TEETH	1006209785 1006209961 2356	AUDI: A3 1.9 TDI - 2.0 TDI - 3.2 QUATTRO SEAT: ALTEA 1.9 TDI - 2.0 TDI VOLKSWAGEN: CADDY III 2.0 SDI, GOLF IV 3.2 R32 4 MOTION 0001123014 /0001123015 0001123016/0001123017 0001123020/ 0001123021
	G	27.8	PINION DIA		
	L	91	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CW		ROTATION		

 FB-18610	T	9	NO OF TEETH	1006209581 135715 1.01.1067.0 52-42-26	Audi : AUDI 1.9L DIESEL (EUROPE) SEE: 120-238A, B (LATER VERSIONS) SEE: 120-238C (EARLIER VERSION) SEE: 108-295 (VALEO VERSION), 80 1.6L D/ TD, 1.9 LTD/ TDI 0001110066/0001110067
	G	25.8	PINION DIA		
	L	58.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

 FB-18611	T	10	NO OF TEETH	SIK001-510	
	G	32.1	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.2	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18612/18082	T	9	NO OF TEETH	M191T12871 31320-60A10 96058480 136602 4-877 54-8321 1.01.0617.0 MT-108K	Mitsubishi: Nissan - Datsun Suzuki: VITARA 金杯 491
	G	29.5	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18613	T	9	NO OF TEETH	SH001-500	
	G	36	PINION DIA		
	L	96.2	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18614	T	10	NO OF TEETH	2130-3500 E0NN11350B A 4-820A 54-8126 1.01.0539.0	Nissan – Datsun: ED30 S1284//S1361A 220-44012 SDHI-2371 W475-108 61-25-14140 1303ST/17088/17294
	G	39.4	PINION DIA		
	L	70	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18615	T	30	NO OF TEETH	M191T17471 M191T19571 23354-0B710 SDE354 F4XY11350B 4-1074 54-83417-1 1.01.1019.0 CSD-6029	For: Mitsubishi PMGR Starters Used On: (2001-94) Mercury, Nissan Unit Nos: Ford F4XY-11002-A,F5XY-11002-A,XF52-11000-AA,XF5Z-11002-AA; Mitsubishi, M1T64285, M1T68081;Nissan23300-0B0 10, -0B711, -7B010 Lester Nos: 17479, 17767
	G		PINION DIA		
	L	93	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	10.7	BUSHING DIA		
	D	46	CLUTCH O/D		
	CCW		ROTATION		

	T	12	NO OF TEETH	028300-1780	For: Nippondenso 4.0kW DD
---	---	----	-------------	-------------	----------------------------------

FB-18616	G	46.3	PINION DIA	4-851 54-8222 1.01.0607.0	Starters Used On: Allis-Chalmers 028000-4930/268757 16627/220-52013 SDND-2058 W475-85/51-29-14000
	L	102	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18617	T	10	NO OF TEETH	028300-1860 4-1038 54-8236 1.01.0813.0	For: Nippondenso 7.5kW DD Starters Used On: Caterpillar, John Deere Unit Nos: Nippondenso 028000-525, 128000-048 Lester Nos: 16655, 17371 16655/17371/220-52030 SDND-2990/W475-137 61-29-14007
	G	40	PINION DIA		
	L	108	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18618	T	10	NO OF TEETH	REF 61181	
	G	32.7	PINION DIA		
	L	56	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18619	T	9	NO OF TEETH	1987BE0053 74893901 74896531 83221541 85540011 85540081 85540381 85540411 9939915 9940577 9941300 9941306 TMM901 132119 134859 1.01.0786.3 1.01.1333.0	Asia Motors: BESTA 1.0 Fiat: CINQUECENTO 0.7 - 0.9, PANDA Fire, Tipo Fire, UNO Fire Lancia: Y10 Fire 63221800/63221830 63221832/63221834 63221890/63221892 63222831/63222832 63222833/63222836 63222837/63222838 63222897/63223001 63223031/63223032 63223033/63223034 223124
	G	25.8	PINION DIA		
	L	64.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		

 FB-18620	T	10	NO OF TEETH	2006209462 2006209499 4-838 131597 138312 1.01.0419.0 54-9153	Daf: F 1400 DF Dodge: TRUCKS S Series Ford: CARGO Series Hanomag: 20, 22 C, 30, 33 C, 400 D Linde: H 20 - H 25 - H 30 220-24033/ SDBO-2411 61-15-6486
	G	39	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

	T	9	NO OF TEETH	9002336236	Mercedes: L 1218, L 1418,
---	----------	----------	--------------------	------------	----------------------------------

	G	34.8	PINION DIA	6033AD0442	712 C, 817-1517 (1996 -), 915 New Holland: Tractor Lester Nos: 18232, 18364, 18958 01319755 01319806
	L	83	LENGTH	6033AD0462	
	SPL	10	NO OF SPLIN	6033AD3006	
	ID	14.3	BUSHING DIA	6033AD3108	
	D	60	CLUTCH O/D	6033AD3244	
	CW		ROTATION	6033AD3850 6033AD4034 6033AD4148 0011511813 0011513213 139056 1.01.1038.0 54-91130-1	
 FB-18622	T	10	NO OF TEETH	9002336223 136787 1.01.1071.0	Mercedes: Steyr Puch: Still: 0001218162/0001218165
	G	27.8	PINION DIA		
	L	59	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18623/18506	T	9	NO OF TEETH	M191T93971 231341 1.01.1063.0	Agrale: Micro Onibus Volare General Motors: S10 Diesel C/ motor MWM., S10 Diesel MWM. Renault: Master Troller: T4 c/ motor MWM apartir de 2000 M002T87771/M002T8877 12A/90572010009502
	G	35.8	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	13	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		
 FB-18624	T	23	NO OF TEETH	F5BU11350AA 54294813 139710 1.01.0975.0 2105 21-41-41	Ford : ESCORT 1.3, ESCORT 1.8, FIESTA 1.0 95FB11000BC/95FB1100 0BD/95FB11000BG/63223 538/63293538
	G	54.3	PINION DIA		
	L	51	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18625	T	10	NO OF TEETH	185290 188256 594136 NE831 135084 1.01.1074.0	Citroën: Xsara Zx D Peugeot: 106D Rover: Tatra
	G	27.8	PINION DIA		
	L	55	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18626	T	11	NO OF TEETH	180826 182177 NE211 TMB275 132021 1.01.0647.0	Citroën: C 25 Diesel, CX 2.5 D Peugeot : 405 D , J5 D D9R90/D9R99 VALEO 1581/6108-2162 26-46-86
	G	34	PINION DIA		
	L	76	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

 FB-18627	T	11	NO OF TEETH	103611 180665 NE413 TMB266 132177 54-9404 54-9427 1.01.0570.0 PG-112	Renault: R 11 D, R 9 D Paris RhôneD10E85/D10E92/D10E922 VALEO SDPA-2037 6108-2037 26-46-49
	G	29.5	PINION DIA		
	L	59	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18628 加大	T	12	NO OF TEETH	97CA11000AB IS7U11000BA YC1U11000AB 233830 1.01.1539.0	Ford: Ford transit 2.4 e Mondeo. STM583-800/ CS1245
	G	38	PINION DIA		
	L	47	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	51	CLUTCH O/D		
	CCW		ROTATION		
 FB-18629	T	9	NO OF TEETH	1987BE0035 611942 SD500 NE314 4-926 131021 1.01.0404.0 54-9416	Citroën: CX Athena - CX Reflex Peugeot: 505 - 505 Inj. Renault : ESTAFETTE, FUEGO, R 16, R 18, R 20, R 4, R 5, R 6, RODEO, TRAFIC VALEO310626 314529
	G	25.8	PINION DIA		
	L	61.5	LENGTH		
	SPL	11	NO OF SPLIN		
	ID	13	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18630/19192	T	8	NO OF TEETH	M191X243BT 235426	Logan 1,4-1,6MPI RENAULT: CLIO III 1.4 1.6, MODUS 1.4 1.6, TWINGO II 1.6 M0T450711ZT/M0T45371 ZT/69-71-14/6001547546
	G	23.8	PINION DIA		
	L	44	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	10.7	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18631	T	11	NO OF TEETH	6033AD0102 6033AD3078 900-986	
	G	34.7	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18632	T	11	NO OF TEETH	SBO036-510	
	G	44.5	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18633	T	11	NO OF TEETH	6033AD0267 6033AD3106 233723 BO-G14043	JOHN DEERE: TRATTORI 0001230002/62-42-01
	G	40	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18634	T	10	NO OF TEETH	028301-0760 028301-0761 22340-5861	For: Nippondenso: 228000-5860, 861, 862. Application: Hyster: Forklift., GM: Engine 4.3L, V6.
	G	41	PINION DIA		
	L	110	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.8	CLUTCH O/D		
	CW		ROTATION		
 FB-18635	T	10	NO OF TEETH	大字	Daewoo:
	G	32.3	PINION DIA		
	L	64	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	43	CLUTCH O/D		
	CCW		ROTATION		
 FB-18636	T	22	NO OF TEETH	76-83839 18490 配 18636/蒙迪欧	Citroën: EVASION TD, JUMPER, JUMPY, XANTIA TD, ZX TD Mitsubishi: Peugeot: 306, 405, 406, 806, BOXER, EXPERT
	G	52	PINION DIA		
	L	37	LENGTH		
	SPL		NO OF SPLIN		
	ID	12	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		
 FB-18637	T	8	NO OF TEETH	1006209794 1006209810 1006209820 6004AHS018 235290 54-91102 1.01.1545.0 CSD-256 6108	Chrysler: Dodge Neon For: Bosch PMGR Starters Used On: (2005-00) Dodge, Plymouth Unit Nos: Bosch 0-001-107-431, 0-001-107-432, 6-004-AA0-003; Chrysler 4793493, 5033556AC Lester Nos: 17790, 17822
	G	27.4	PINION DIA		
	L	46	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18638	T	9	NO OF TEETH	258.3556 OCM0102	Peugeot:
	G	25.8	PINION DIA		
	L	55	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW	VAL EO	ROTATION		

 FB-18639	T	23	NO OF TEETH	F8BU11350AA TMM990 1.01.0890.0 DRV354 10671 222514	Ford: Courier, Fiesta, Ka
	G	54.3	PINION DIA		
	L	46.6	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		

 FB-18640	T	9	NO OF TEETH	DRV012	
	G	25.8	PINION DIA		
	L	60.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.2	CLUTCH O/D		
	CW		ROTATION		

 FB-18641	T	8	NO OF TEETH	66242193 没确认	
	G	27.4	PINION DIA		
	L	65.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18642	T	13	NO OF TEETH	M191T66271 E8PZ11350A SDE339 139609 54-8320 1.01.0669.0	Ford: E-F VAMS, Tractor Mitsubishi: 17037/ SDMI-2390 W475-82/61-27-14129
	G	40	PINION DIA		
	L	109	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18643/5965/8897	T	20	NO OF TEETH	华腾	
	G	14.95	PINION DIA		
	L	82	LENGTH		
	SPL	4	NO OF SPLIN		
	ID		BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18644	T	9	NO OF TEETH	9001453336 BD5T11350A T11911335A TNB402 1.01.0085.0	Agrale: TX 1600 (MWM) Ford: F1000, 11000, 2000, 400, 4000, 7000 (MWM), 14000 1.01.1361.0 加厚 224026 222402
	G	34.7	PINION DIA		
	L	79.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18645	T	10	NO OF TEETH	9001453333 9001453334 9001453338 BC4N11350A 07328970 TNB460 1.01.0024.0	Case: 580/E/CK (Perkins) Clark: 75A-II-III, 300/HY 40/50/60, C-500 Y110/135/155 Perkins: 4 - 6 CIL 224043/2244036/9777/W4 70-124/04128642/224004 224038/1.01.1359.0/0100 024.4 加厚
	G	39.5	PINION DIA		
	L	79.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18646	T	12	NO OF TEETH	6033AD0129 233722 1.01.1160.0	Volvo: FM 1998 0001231004/62-42-00
	G	46.5	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.2	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18647/18364	T	10	NO OF TEETH	2006209414 2006209444 9002453077 131495 3-669 1.01.0497.0	JohnDeere(SLC): JHD 900, 1000 - JD 300 - 310 - 350 - 400 , MD 925 - 930 - 932 - 935 - 940 Perkins: 4 - 6 CIL 61-15-6441/SDBO-3231 16563/17309/32-42-31 W470-039
	G	32	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18648	T	12	NO OF TEETH	1C3U11350AB 54-217 1.01.1081.0 220-14040 6150361 6669 6670 802201 202395	Ford: HEAVY DUTY F250 / F350 SERIES, LT TRUCKS E-SERIES VANS 7.3 L - DIESEL , LT TRUCKS EXCURSION 7.2 L - DIESEL 1C3U11000AA/1C3U11000A B/1C3U11000AC/1C3U1100 0AD/1C3U11000AE/1C3Z11 002AA/2C2411000AA Ford 3.0-3.5kW OSGR Starters
	G	37.8	PINION DIA		
	L	116	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64.4	CLUTCH O/D		
	CW		ROTATION		

 FB-18649	T	9	NO OF TEETH	028300-2120 028300-3740 028300-7160 028300-7910 23312-AA030 136745 54-8219 ND-G0929A	
	G	29.5	PINION DIA		
	L	83	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.8	CLUTCH O/D		
	CCW		ROTATION		

 FB-18650	T	11	NO OF TEETH		
	G	40.5	PINION DIA		
	L	85	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18651	T	9	NO OF TEETH	华腾	
	G	34.5	PINION DIA		
	L	83	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.8	CLUTCH O/D		
	CW		ROTATION		
 FB-18652	T	11	NO OF TEETH	28011-1350 28011-1351 136512 SF-307	136104900/ H06C H07C W06D
	G	40.5	PINION DIA		
	L	80	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	71	CLUTCH O/D		
	CW		ROTATION		
 FB-18653	T	10	NO OF TEETH	18415	
	G	32	PINION DIA		
	L	96	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18654	T	11	NO OF TEETH	F002G20870	
	G	34.8	PINION DIA		
	L	81	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CCW		ROTATION		
 FB-18655	T	10	NO OF TEETH	1006209661 0011512113 234242 1.01.1485.0 54-9196	Chrysler: CROSSFIRE 3.2L - 3199cc 2004-2005 Mercedes : C240 2.6L - 2597cc 2001-2004 C32 3.2L - 3199cc 2002-2004 C320 3.2L - 3199cc 2001-2004 CLK320 3.2L - 3199cc 2001-2004 E320 3.2L - 3199cc 2001-2004 ML320 3.2L - 3199cc 2001-2003 ML350 3.7L - 3724cc 2003-2004 C32 3.2L - 3199cc 2002-2004 C320 3.2L - 3199cc 2001-2004 CLK320 3.2L - 3199cc 2001-2004 E320 3.2L - 3199cc 2001-2004 ML320 3.2L - 3199cc 2001-2003 ML350 3.7L - 3724cc 2003-2004 SLK32 3.2L - 3199cc 2002-2004 SLK320 3.2L - 3199cc 2001-2003
	G	27.8	PINION DIA		
	L	70	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

 FB-18656	T	9	NO OF TEETH	28100-0D140 8870 TE428000-285 0	丰田花冠起动机
	G	29.5	PINION DIA		
	L	64	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	44.3	CLUTCH O/D		
	CW		ROTATION		
 FB-18657	T	8	NO OF TEETH	F002G20780	
	G	28.4	PINION DIA		
	L	83	LENGTH		
	SPL	11	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		
 FB-18658	T	9	NO OF TEETH	1006209981 1006209799 28011-0D130	BMW :E60/65/70/71/81/ 83/87 TOYOTA : Yaris 1,4VVTi 07-.
	G	29.7	PINION DIA		
	L	47.7	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18659	T	11	NO OF TEETH	2006209542	
	G	40.4	PINION DIA		
	L	91	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18660	T	11	NO OF TEETH	28011-1990	
	G	40.5	PINION DIA		
	L	149.5	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	57	CLUTCH O/D		
	CW		ROTATION		
FB-18661	T	11	NO OF TEETH	1304-24-709 M191T61172	LESTER18170 MAZDA4857-18-100 MTSUBISHI/M6T-20471 PIC 103-369
	G	44.8	PINION DIA		
	L	120	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18662	T	11	NO OF TEETH	9941846 85540321 85541040 134364 1.01.0878.0 1747 AS/SD4019 SDV37039	Fiat: CROMA 2.0, PANDA D, TEMPRA 1.8 - 2.0 - 4x4, TIPO 1.6 - 1.8 - 2.0, UNO D, UNO D Lancia: DEDRA 1.8 - 2.0, DELTA 1.8 - 2.0, K 2.0 - 2.4 (20 v, THEMA 2.0 Lombardini: LDW 502 - 602 - 903 - 1204 63223430/63223431/63223432/63223436/63223530 /63223531/63223532
	G	29.5	PINION DIA		
	L	52.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18663	T	9	NO OF TEETH	9948135 83226569 85541700 139902 1.01.1025.0 2092 AS/SD4032 SDV37625	Fiat: DUCATO 2.5 - 2.8 TD Fiat Iveco: DAILY 2.8 TD, Ducato 2.8 modelos: 719, 720, 721, 722, 723, 724, 725, 726, 729. Peugeot: Peugeot Boxer 131955508/63114014/E95RL
	G	34.8	PINION DIA		
	L	64.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18664	T	10	NO OF TEETH	83280040 83280041 2391	Used On: Perkins Engines Replaces: Marelli 63280040; Massey Ferguson 3784889M2, 3784890M1, 3823621M91; Perkins 2873K404, 2873K621 LESTER: 18941
	G	40	PINION DIA		
	L	73	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	62	CLUTCH O/D		
	CW		ROTATION		
 FB-18665	T	9	NO OF TEETH	26255515	
	G	25.8	PINION DIA		
	L	91.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18666	T	9	NO OF TEETH	28021-73020 237379 331969 428000-0607 428000-0680 2379	BMW: 316i - 318i - 318is - 320i - 323i 2.5 - 328i,325i - 325xi - 330i - 330xi,520i - 523i - 525i - 528i - 530i,728i - iL - 730i - i - iL ,X3 2.5i - 3.0i ,Z3 1.8 - 1.9 - 2.0 - 2.2 - 2.8 - 3.0 Z4 - 2.2i - 2.5i - 3.0i HYUNDAI: COUPE' 2.0 16V TOYOTA: AVENSIS 1.6 - 1.8 VVT-I,COROLLA 1.4 - 1.6 - 1.8 VVT-I,MR 2 1.8 16V VT-i (ZZW30)
	G	29.7	PINION DIA		
	L	42	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18667	T	11	NO OF TEETH	9936050 9938235 9941642 SD187 74891161 74898071 85540521 132188 1.01.0394.0	Audi: Fiat: ARGENTA, CROMA, REGATA , UNO D , 124 Spider, 127 D, 131 2.0 - 132 2.0 Lancia: BETA 2.0, DELTA 1.6 HF Turbo , PRISMA 1.6 / 4WD, THEMA 2.0
	G	29.5	PINION DIA		
	L	65.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18668	T	12	NO OF TEETH	1006209824 1006210146 330265 1.01.1642.0	Citroën: Jumper Fiat: Ducato Land Rover: Defender engine 2.4 TD4 from year 2007 on Peugeot: Boxer, Boxer engine 2.2 HDI from year 2006 on 0986021810/0001109205/00 01109324/6049
	G	38.8	PINION DIA		
	L	56	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

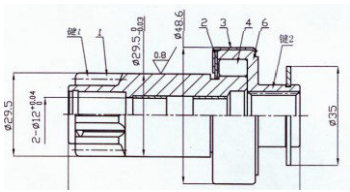
 FB-18669	T	9	NO OF TEETH		
	G	32.5	PINION DIA		
	L	146.5	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	57	CLUTCH O/D		
	CCW		ROTATION		

 FB-18670	T	8	NO OF TEETH	36145-25010 克萊斯勒 ASC-BND-857 7	Hyundai:
	G	28.4	PINION DIA		
	L	48	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		

 FB-18671	T	10	NO OF TEETH		
	G	27.8	PINION DIA		
	L	38.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		

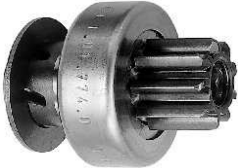
 FB-18672	T	9	NO OF TEETH	9001336213 9001336217 130730 1.01.0543.0	EBRO: SIATA 50S FIAT: 850-850T SEAT: 850-130 MIA12-13/MIA12-41 17061-2 17061-8 SDV37001 09-51-88
	G	25.8	PINION DIA		
	L	62.7	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	45	CLUTCH O/D		
	CCW		ROTATION		

 FB-18673	T	10	NO OF TEETH	新产品要对图 纸加拿大 2 号	
	G	40	PINION DIA		
	L	137	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18674	T	12	NO OF TEETH	0-23000-6250 0-23000-6530 0-23000-8300 0-23500-0092 1-23500-0160 1-23500-0170 132519 NIK-216	KOMATSU: 6 D 125 LESTER: 18107 SDV38680/1825/ SD9012
	G	46.3	PINION DIA		
	L	97	LENGTH		
	SPL	15	NO OF SPLIN		
	ID	19	BUSHING DIA		
	D	71	CLUTCH O/D		
	CW		ROTATION		
 FB-18675	T	9	NO OF TEETH	0-23000-1260 0-23000-1310 0-23000-1700 0-23000-2100 0-23000-2101 0-23000-2201 0-23000-2541 0-23500-0320 0-23500-0323 8943374550 136139	LESTER: 18194 PIC 185-260/185-260A PIC 910-323 8944545590 8970298630 8970298634 111254
	G	36.3	PINION DIA		
	L	83	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18676	T	9	NO OF TEETH		AUDI: A8 2004 V8 4.2L LESTER: 17888/17889 PIC108-470 VALEO191151/439167/45818 6/D7GS17 VW.AUDI:077911023K/07791 1023J
	G	29.6	PINION DIA		
	L	82	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18677	T	8	NO OF TEETH	M191T15871 59-71-81	MITSUBISHI:
	G	28.4	PINION DIA		
	L	42.2	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CW		ROTATION		
 FB-18678	T	9	NO OF TEETH	31200PG395J 31204PD1003 31204PD1013 31204PH3006 31204PJ7903 134284 4-769 54-8500 1.01.0815.0 CSD-6026 CSD-6027 1767 3-769	For: Mitsuba OSGR, PMGR Starters Used On: (1995-84) Acura, Honda Unit Nos: Mitsuba SM302-02, SM302-04, SM302-07, SM302-08, SM302-16, SM302-18, SM302-22, SM302-24, SM302-25, SM302-28, SM302-44, SM302-45, SM302-46, SM302-48, SM402-03, SM402-04, SM402-05, SM402-10N, SM402-11N, SM402-13N, SM402-15, SM402-16 N Lester Nos: 16845, 16901, 16902, 16914, 16960, 16975, 17052, 17156, 17160, 17201, 17205, 17474, 17491, 17527
	G	30	PINION DIA		
	L	99	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	62	CLUTCH O/D		
	CW		ROTATION		

 FB-18679	T	11	NO OF TEETH		LESTER: 18057 HITACHI: S210-108 S210-108A/S210-108N ISUZU: 1-81100-1800 1-81100-1801/1-81100-2521 PIC: 104-293/104-293B
	G	49.7	PINION DIA		
	L	98	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	18	BUSHING DIA		
	D	75.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18680/19130	T	9	NO OF TEETH	31204P54003 31204P72A01 31204P72A01 0M 31204PAAA01 31204PH3003 8970414270 028300-7610 028300-7680 028300-7860 028300-8100 028300-8600 233456 54-8249 ND-G0929E	For: Nippondenso 1.2-1.4kW OSGR Starters Used On: (2004-93) Acura., Honda, Isuzu
	G	29.5	PINION DIA		
	L	83	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.8	CLUTCH O/D		
	CW		ROTATION		
 FB-18681	T	11	NO OF TEETH		
	G	29.7	PINION DIA		
	L	77.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18682/19235	T	10	NO OF TEETH	10452918 1.01.1614.0	Ford: Pick-Up Lobo V6 9000869
	G	27.8	PINION DIA		
	L	47	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.2	CLUTCH O/D		
	CW		ROTATION		
 FB-18683	T	10	NO OF TEETH	028300-7530 028300-6840 4-1057 233398 54-8237 1.01.0948.0 CSD-948 6190-2991	Case: EHC John Deere (SLC): For: Nippondenso 4.0kW IIF DD Starters Used On: Case, Cummins, International, John Deere Unit Nos: Nippondenso 128000-533, -597, -723, -725, -969, -980; 228000-136, -138, -139, -140, -236, -237, -469 LESTER: 17353/17618/1762 4/17625/17633/18272
	G	40	PINION DIA		
	L	103.5	LENGTH		
	SPL	18	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18684	T	12	NO OF TEETH		LESTER: 18570 428000-1210 428000-1211 428000-1212
	G	57	PINION DIA		
	L	106	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	71	CLUTCH O/D		
	CW		ROTATION		
 FB-18685	T	11	NO OF TEETH	1024030	4817036 要确认
	G	36.5	PINION DIA		
	L	46.6	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 GWARANCJA PRODUCENTA FB-18686	T	9	NO OF TEETH		4815081 要确认
	G	30	PINION DIA		
	L	87	LENGTH		
	SPL	14	NO OF SPLIN		
	ID	10	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 GWARANCJA PRODUCENTA FB-18687	T	11	NO OF TEETH	188270 594389 594699 231093 36-46-22 2387 4817017	AUDI: A3 1.4,1.9 TDI, FORD: Galaxy 1.9 TDI, 2.0,2.3, SEAT: 1.4,1.9 TDI,SDI,TD, SKODA: Octavia 1.9 TDI, VOLKSWAGEN: 1.4,1.9 TDI,SDI,TD
	G	29	PINION DIA		
	L	91	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18688	T	9	NO OF TEETH	9490	
	G	29.5	PINION DIA		
	L	58.5	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	44	CLUTCH O/D		
	CW		ROTATION		
 FB-18689	T	10	NO OF TEETH	16.902.733 16.904.847 231623 1.01.1600.0 SDV37312	Case: CS130 / CVX150 / CVX170 6cyl.Turbo Landini: ATLAS Perkins 1004 Massey Ferguson: MF 8160 634DS, MF 8250 634DWE Ursus: C-330M/335 S312C, C-360 S4003 Valmet: 8400 620DS Turbo, BF65/BF75/BM85 100/110/120 BL77/88700/800/900/BH140/ 160/180 12V, VALTRA (VALMET) 255 / 355 320D, VALTRA (VALMET) 365S / 455 / 656 / 6100 320DS Turbo
	G	39.4	PINION DIA		
	L	83	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18690	T	9	NO OF TEETH	1006209818 1006209964 1006210111 1006210149 237667 1.01.1650.0	Citroën : Citroen Relay 2.8Hdi, Jumper 2.8 HDI Fiat: Ducato 2.3 / 2.8 JTD Fiat Iveco: Daily III 2.4 / 2.8, Microônibus City Plus 2009 Peugeot: Boxer 2.8 HDI IVECO 500053567 50053567
	G	35.8	PINION DIA		
	L	54	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	52	CLUTCH O/D		
	CW		ROTATION		
 FB-18691	T	11	NO OF TEETH	2E24 856091	
	G	29.7	PINION DIA		
	L	45	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18692	T	9	NO OF TEETH	2E24 856091	
	G	35.8	PINION DIA		
	L	69	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18693	T	8	NO OF TEETH	40217	
	G	28.4	PINION DIA		
	L	55	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	43.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18694	T	11	NO OF TEETH	ISKRA 16.900.035 130415 1.01.1088.0 2265	
	G	29.5	PINION DIA		
	L	62.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18695	T	10	NO OF TEETH	1195334 不确认	VALEO
	G	28	PINION DIA		
	L	45	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CW		ROTATION		

 FB-18696	T	8	NO OF TEETH		ZEN ESTILO
	G	28.4	PINION DIA		
	L	60	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	41.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18697	T	8	NO OF TEETH		VALEO LAURA DSL
	G	28.4	PINION DIA		
	L	43	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.1	CLUTCH O/D		
	CW		ROTATION		
 FB-18698	T	11	NO OF TEETH	192750	VALEO TYPE
	G	29.7	PINION DIA		
	L	81.5	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CCW		ROTATION		
 FB-18699	T	10	NO OF TEETH	F002G20867	
	G	32	PINION DIA		
	L	55	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18700	T	9	NO OF TEETH	54-219/3-595 CHRYSLER FO-1908 FACET480031 /480180/48036 8 C2AF11350A C2AZ11350B C2AZ11350C C2AZ11350E C4AF11350A	Used On: Ford, Mercury Unit Nos : Ford C2AF11001A,C2AF11001 B,C2AF11001C,C2AZ110 01A,C2AZ110012A,C2DF 11001A;Prestolite MCL-6502,MHB-4004, 46-395, 46-877, 48-906, 46-931 Prestolite EBB-106,EBB-133, 59-161; Leece Neville M0290-4595
	G	29.7	PINION DIA		
	L	108/1 22	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		
 FB-18701	T	9	NO OF TEETH	4-593LG	
	G	25.8	PINION DIA		
	L	99	LENGTH		
	SPL		NO OF SPLIN		
	ID	12	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18702	T	9	NO OF TEETH	54-162	For : Delco, Prestolite Starters Unit Nos: Delco 1107899, 1107900, 1109511, 1109512, 1109517; Prestolite MCH6117, MDT7020, MDU6016, MDU6017, MDU7005, MDU7015, MDU7025, MDU7026, MDU7032, MDU7034, MDU7037, MDY7021, MDY7023, MDY7024, MDY7045, MDY7045A, MEO7003, MHA7005, MHB4001, MHB4002, MHB4003, MHB4010, MHB4011, MHB4012, MHB4013, MZ4205, MZ4206, MZ4217, MZ4218, MZ4219
	G	25.8	PINION DIA	4-593	
	L	91/10	LENGTH	Delco 1952769, 1961309; 1961389	
	SPL		NO OF SPLIN	D2019	
	ID	12	BUSHING DIA	AMC930405/9	
	D		CLUTCH O/D	31670	
	CW		ROTATION	FACET479006 /480045/48027 1/480326/4803 74/480379/480 386/480387 Prestolite 59-2, 59-174, EBB-75, -75A; LEECE MO290-4593 LYCOMING LW-7425Y	

 Copyright © WAI FB-18703	T	9	NO OF TEETH	54-145	For : Delco, Prestolite Starters Unit Nos: Jeep, Massey Ferguson Unit Nos: Delco 1107226; Prestolite MDU-7003, MDU-7017, MDU-7036
	G	29.7	PINION DIA	4-594	
	L	91/10	LENGTH	AMC924885/9 25667/931463	
	SPL	6	NO OF SPLIN	Delco 1956210; 1963470	
	ID	15.9	BUSHING DIA	FACET479000 /480042/48006	
	D		CLUTCH O/D	9/480373/4803 78/480380	
	CW		ROTATION	Prestolite 59-162, 59-46, EBB-104, EBB-74B LEECEMO290 -4594 MASSEY1019 -269-M91	

 Copyright © WAI FB-18704	T	9	NO OF TEETH	54-604/4-593L	STARTER: PRESTOLITE MDU7033 , MHA7006 , MHB4014 PIC: 160-158, 160-188 LESTER5175
	G	25.8	PINION DIA	H//DELCO	
	L	91/10	LENGTH	1963422	
	SPL	7	NO OF SPLIN	FACET480013 /480085/48037 5/480382	
	ID	15.9	BUSHING DIA	PRESTOLITE	
	D		CLUTCH O/D	59-142/59-176 /59-204/63-86/ EBB-142A/EB	
	CCW		ROTATION	B-89/MGL-126 1	

 Copyright © WAI FB-18705	T	9	NO OF TEETH	3-520/3-565R C/3-565 CASE A25600 CATERPILLA R 9F-3491 CHRYSLER 3837936 DELCO18780 79/1887463/19 13587/191358 9/1918219/197 1147/D2010 FACET480193 /480383/A-179 2/A-1915/A-23 10/A-3072 MASSEY1035 -335-M91/175 0-454-M91 PERSTOLITE 63-5/63-8/63-9 6/EBA-33	For: Delco, Prestolite Starters Used On: Buffalo Springfield, Case, Caterpillar, Clark, Hyster, International, John Deere, Massey Ferguson, Towmotor Unit Nos: Delco 1107163, 170, 176, 178, 195, 197, 202, 231, 238, 494, 761; 1108085, 086; 1109389, 453, 460, 501, 508, 623, 691; Prestolite MBG-4107A
	G	29.7	PINION DIA		
	L	116/1 35	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 Copyright © WAI FB-18706	T	9	NO OF TEETH	54-602 4-575 3-575 Prestolite 59-182, 59-184, EBB-131A FACET 480173 480388	For: Prestolite Starters Used On: Jeep, Mercury Marine Prestolite 46-850, 46-2273, MDU-7028, MDY-7015, MHA-7016, MHB-4016, MHB-4017, MHB-4019, MHJ-4001UT, MZ-4221, MZ-4222, MZ-4223
	G	25.8	PINION DIA		
	L	106/1 20	LENGTH		
	SPL		NO OF SPLIN		
	ID	12	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 FB-18707	T	10	NO OF TEETH	FACET 10586 Prestolite 59-257, EBC-1 Prestolite 46-2577, MHA-7021 3-599 54-605	For: Prestolite Starters Used On: TCM Wisconsin
	G	36.5	PINION DIA		
	L	106/1 20	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		

 FB-18708	T	9	NO OF TEETH	Delco 1956869, 1964299; Prestolite 59-51, 59-168; EBB-97, A Delco 1107163, 170, 176, 178, 195, 197, 202, 231, 238, 494, 761; 1108085, 086; 1109389, 453, 460, 501, 508, 623, 691; Prestolite MBG-4107A 3-570 54-147	For: Delco, Prestolite Starters Used On: Buffalo Springfield, Case, Caterpillar, Clark, Hyster, International, John Deere, Massey Ferguson, Towmotor
	G	36.8	PINION DIA		
	L	116/1 35	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 FB-18709	T	10	NO OF TEETH	Prestolite 59-194, EBB-137A 46-911,46-912 46-921,46-923 46-965, MBG-4140, MBG-4141, MBJ-4101, MZ-4212, MZ-4213 54-606/4-597	For: Prestolite Starters Used On: Allis-Chalmers, Case, Ford Tractors, International, John Bean, John Deere, Massey Ferguson, New Holland, Wisconsin
	G	36.5	PINION DIA		
	L	106/1 20	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		
 FB-18710	T	10	NO OF TEETH	4-554/D554 1925580 1958452 480345 3-554RC	STARTER : DELCO 1107246,1109244,110924 6,1109507 LESTER:5180/5225/5488
	G	39.4	PINION DIA		
	L	117/1 35	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		
 FB-18711	T	9	NO OF TEETH	FACET480012 ,480349,48035 4,INGERSOLL 3BM-299-19 PRESTOLITE 59-118,59-129 ,59-133.59-52. 63-60,63-94,E BA-87,EBB-33 EBB-41,EBB-6 9/4-582LH	STARTER:PRESTELITT, MAY4149M,MCH6208M, MCL6128M,MCL6203M,M CT6106M,MCT6202,MDT 6011,MDT7010,MDT7016
	G	25.8	PINION DIA		
	L	117/1 33	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		
 FB-18712	T	10	NO OF TEETH	CASE,A25641 A40307 CATERPILLA R67410,68573 ,88285 CLARK887540 DELCO18568 69,188817,191 6663,1921299, 1929359,1938 973,1948307,1 854860,19568 69,1964299,19 61993,196429 9,1970739 FACET478730 ,478979,48001 9,480034,4803 43,480359 FORD,SDX21 8,SDX224 HYSTER1089 44 INGERSOL LREND3BM-2 99-4 LEECE MO290-4570 4-568/54-146 TOWMOTR A68753,A8828 5	STARTER:DELCO110716 3.1107170.1107176.11071 78.1107195.1107197.1107 202.1107231.1107238.110 7494.1107761.1108085.11 08190.1109389.1109453.1 109460.1109501.1109508. 1109623.1109691 PRESTOLITE:46-77.46-7 8.46-79.46-81.MBG4107. MBD4107A.MBD4108A.M BD4108.MBJ4114A.MGB4 107.MZ4166.MZ4174 PIC:140-018.140-032.140 -035.140-056.140-062.14 0-067.160-177.140-177A. 140-178.140-178A LESTER:4082,4088,4225, 4499,4760,4764,5217,528 7,5448,5449
	G	39.4	PINION DIA		
	L	116/1 35	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		



FB-18713

T	9	NO OF TEETH	1922266	STARTER:1107092/1107115 /1107116/1107125/1107126/1 107139/1107173/1107196/11 07198/1107217/1107235/110 7253/1107605/1107658/1107 659/1107695/1107728/11077 45/1107746/1107747/110775 5/1107787/1107977/1108008 /1108029/1108037/1108057/ 1108068/1108077/1108078/1 108106/1108149/1109384/32 3-659 LESTER:3573/3679/4157/41 66/4481
G	29	PINION DIA	D2012	
L	116/1 35	LENGTH	59-34 EBB-19 54-144 4-565HD	
SPL		NO OF SPLIN		
ID	15.9	BUSHING DIA		
D		CLUTCH O/D		
CW		ROTATION		



FB-18714

T	9	NO OF TEETH	Delco	For : Delco, Prestolite Starters STARTER: Delco 1107213, 1107258,1107261,110726 5,1107322,1107741,11077 58,1107788,1107881,1107 928,1108014,1108032,110 8046,1108047,1108048,11 08052,1108056,1108061,1 108062,1108063,1108064, 1108065,1108066,110807 1,1108113,1108152,11081 63,1108166,1108168,1108 169,1108170,1108171,110 8182,1108198,1108198,11 08258,1109371,1109388, 1109395,1109396,110946 2,1109479,1109674,11099 02,1109923,1109934,1109 946,1998201,1998202; Prestolite MAW4046, MAW4046M, MAX-4082, MAX4047, MAX4056, MAX4069, MAX4069M, MCH6002, MCH6002M, MCH6208T, MCL6002M, MCZ4005UT, MHN4101UT, MZ4005UT Lester: 4076, 4173, 4198, 4321, 4323, 4324, 4327, 4332, 4379, 4380, 4439, 4441, 4442, 4443, 4449, 4450, 4471, 4471, 4472, 4476, 4502, 4765, 4765, 4889, 4890, 4891, 4903, 5053, 5056, 5061, 5105
G	29.7	PINION DIA	1883768, 1922419, 1933214, 1938976, 1939178, 1950398, 1954437, 1954937, 1958842, 1961372; Prestolite 59-141, 59-210, EBB-4, EBB-4A, EBA-44, EBA-44A, EBB-78A, EBB-111, EBB-159A; Ref. Nos.	
L	116/1 35	LENGTH		
SPL		NO OF SPLIN		
ID	15.9	BUSHING DIA		
D		CLUTCH O/D		
CCW		ROTATION		



FB-18715

T	10	NO OF TEETH
G	40	PINION DIA
L	94.5/108	LENGTH
SPL		NO OF SPLIN
ID	15.9	BUSHING DIA
D		CLUTCH O/D
CW		ROTATION

Delco
1850844,
1887579,
1887597;
Prestolite
59-11, EBA-2
4-135/54-143

142, 175, 183,
187, 201, 202,
204, 205, 207,
208, 209, 210,
211, 213, 215,
217, 219, 221,
222, 223, 401,
402, 403, 405,
407, 408, 409,
455, 457, 468,
469, 470, 526,
533, 535, 908,
936; 1109380,
382, 387, 391,
452, 603, 607,
608, 610, 611,
613, 616, 620,
692, 753;
1113062, 129

For: Delco, Prestolite
Starters
Used On: Allis Chalmers,
Ford, Lincoln Electric,
Mack, Massey Ferguson,
New Holland, Oliver, JI
Case, Chris-Craft,
Chrysler Marine, Clark,
Hyster, International,
Jeep, John Deere,
Kenworth, Wisconsin
STARTER: Delco 1107010,
012,014,016,025,028,040,
042,052,058,065,073,077,
086,090,091,133,147,148,
166,175,180,183,185,190,
191,192,254,255,256,257,
276,358,401,403,404,405,
407,409,410,411,413,414,
417,419,421,422,423,424,
426,428,429,435,437,439,
442,443,445,447,455,456,
459,462,477,479,480,481,
482,483,488,493,611,663,
682,685,698,699,713,733,
736,756,801,808,809,811,
812,813,814,815,821,824,
827,828,833,834,835,837,
838,839,842,844,846,847,
849,851,852,897,905,917,
926,933,939,944,958,964,
967,970,972,976;1108006
009,043,045,067,081,083,
084,090,094,102,103,109,
111, 122, 130,



FB-18716

T	9	NO OF TEETH
G	36.8	PINION DIA
L	94.5	LENGTH
SPL		NO OF SPLIN
ID	12.8	BUSHING DIA
D		CLUTCH O/D
CW		ROTATION

4-107



FB-18717

T	10	NO OF TEETH
G	40	PINION DIA
L	95/109	LENGTH
SPL		NO OF SPLIN
ID	15.9	BUSHING DIA
D		CLUTCH O/D
CCW		ROTATION

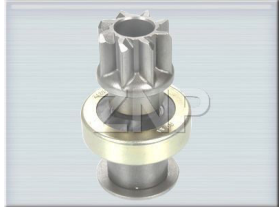
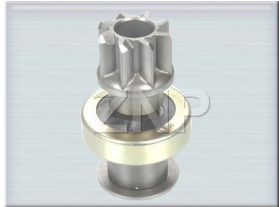
4-121
4-121RT
FACET480400

 Copyright © WAI FB-18718	T	9	NO OF TEETH	Ford 1BA1101A, 1CM-11002-A, B5C-11002-A, B6A-11002-A; C3NF-11001-A , -D, -E; FAC-11000, FAC-11001,-B, -G, -H, -M, -P; FAC-11002, -B,-G; FAE-11002-A; FAG-11001-D; FAG-11002-B, -D, -G, -M; FAJ-11001-D; FAR-11001-A, FAR-11002-A; FAY-11001-A, -B; Prestolite MDU7028, MDU7028S, MDU7029, MEO4001, MEO4002, MMG4002 54-213 4-553	Ford, Prestolite Starters Ford C1AZ-11350-A; Prestolite 59-146, 59-195, 59-248, EBB-95, EBB-132, EBB-174; Ref. Nos. 480179, 480367 Lester Nos3108, 3110, 3115, 5161, 5161, 5162
	G	29	PINION DIA		
	L	123/1 40	LENGTH		
	SPL		NO OF SPLIN		
	ID	15.9	BUSHING DIA		
	D		CLUTCH O/D		
	CCW		ROTATION		

 Copyright © WAI FB-18719	T	9	NO OF TEETH	4-582 CHRYSLER CH-1908 CH-1918 DELCO19337 91/1935744/19 39444/195165 6/1952486/D2 018 FACET478971 /479056/48000 1/480003/1803 51/480352/480 353/A-3467/A- 3474/A-3519/A -3596 FORD290080 4 INGERSOLL 3BM-299-12 LEECE MO290-4582	STARTER: 1107749,11076 51,1107666,1107748,1107 749,1107893,1109504,110 9505,1109506,1109695,11 09696 LESTER3454,3597
	G	25.8	PINION DIA		
	L	107/1 33	LENGTH		
	SPL		NO OF SPLIN		
	ID	12	BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		

 FB-18720	T	13	NO OF TEETH	72046313 72046311 72313050 72315665 15665	
	G	46.3	PINION DIA		
	L	77.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18721	T	13	NO OF TEETH	S114-829 S114-829A S114-829B 231795 1.01.1557.0 SD2021 SD-4161	OPEL: Astra G1.7L TD 1998
	G	33.5	PINION DIA		
	L	38	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12.5	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		

 FB-18722/19101	T	10	NO OF TEETH	186798 187961 187981 594177 594252 NE877 137733 1.01.0833.1 1.01.1209.0 PG-E02822 1999 36-46-10	General Motors: Calibra 2.0 / 2.0i / 2.0i 16V, Corsa, Suprema 2.0 / 2.2 / 3.0 Opel: ASTRA 1.4 / 1.6 16V / 2.0 / 2.0 16V, COMBO 1.2 - 1.4, CORSA 1.2 - 1.4 - 1.6 16v, TIGRA 1.4 - 1.6 16v, Vectra 1.6 16V / 2.0 GLS MPFi / 2.0 GSi MPFi Renault: CLIO 1.2 - 1.4 - 1.6, Clio 1.8, LAGUNA 1.8 - 2.0, Megane 2.0, R19 1.8, Scenic 2.0 Volvo: 440, 460, 480, S 40, V 40
	G	28	PINION DIA		
	L	51.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW	VAL EO	ROTATION		
 FB-18723	T	11	NO OF TEETH	MARELLI 85553621 239080 2398 428000-1640 085553621010	CITROEN: BERLINGO 1.1 - 1.6 HDi, C1 - C2 - C3 - C4 - C5 1.4 - 1.6 - 2.2 HDi, JUMPY 1.6 HDi, NEMO 1.4 HDi, XSARA 1.4 - 1.6 HDi FIAT: SCUDO 1.6 D Multijet PEUGEOT: 107 - 206 - 207 - 307 - 407 - 1007 1.4 - 1.6 HDi BIPPER 1.4 HDi, EXPERT 1.6 HDi, RANCH 1.6 HDi
	G	30	PINION DIA		
	L	42	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18724	T	10	NO OF TEETH	26242763	Mitsubishi: L 200; L 300; 4D56 For: Mitsubish 2.0-2.2kW PLGR Starters Used On: Mitsubishi 2.5L Diesel (Europe) Unit Nos: Mitsubishi M2T84071, M2T84171, M2T84571, M2T87071, M2T87171, M2T87271, M2T87471
	G	32	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18725	T	8	NO OF TEETH	26253628	
	G	28.4	PINION DIA		
	L	57.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CW		ROTATION		
 FB-18726	T	9	NO OF TEETH		FABIA PET
	G	25.8	PINION DIA		
	L	75	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.8	CLUTCH O/D		
	CCW		ROTATION		
 FB-18727	T	9	NO OF TEETH	15984	
	G	35.8	PINION DIA		
	L	62	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	46.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18728	T	11	NO OF TEETH	192467	
	G	28	PINION DIA		
	L	72.5	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	49	CLUTCH O/D		
	CW		ROTATION		
 FB-18729	T	8	NO OF TEETH	234404 54-8252-1 1.01.0974.1 1.01.1218.0 BRP 278-001-497 278-001-936 SEA DOO 278-001-106	Sea Doo: Sea Doo - série 800 (modelos novos). For: Nippondenso PMDD Starters Used On: (2005-99) Sea-Doo 3D DI, GSX, GTI, GTX 782cc Personal Watercrafts (PWC) Unit Nos: Bombardier 278-001-497, 278-001-936; Nippondenso 228000-624 Lester Nos: 18531 WAI Ref. Nos: 2-2769-ND
	G	28	PINION DIA		
	L	34	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		
 FB-18730	T	9	NO OF TEETH	028300-6000 028300-7710 028300-7711 4-972 54-8239 139083 1.01.0773.0 SEA DOO 295-500-089 CSD-773	Sea Doo: GSX, GTI, GTS, GTX,HX,SP (Bombardier), SP1, SPX, XP. Todos os modelos exceto 951 , 580, 650, 720 e 110 Ano 1995 Watercrafts (PWC) & Jetboats Unit Nos: Nippondenso 128000-486, 228000-456; Sea-Doo 278-000-300, -316, -485
	G	29.9	PINION DIA		
	L	34	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		
 FB-18731	T	11	NO OF TEETH	230760 4-956 54-8149 1.01.0754.0 YANAHA 6K8-81807-10-00	Yamaha: LX500, Personal Watercrafts (PWC) Unit Nos: Hitachi S108-102, A, B
	G	33.5	PINION DIA		
	L	40	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47	CLUTCH O/D		
	CCW		ROTATION		
 FB-18732	T	9	NO OF TEETH	028300-5900 编号大概有问题	
	G	29.5	PINION DIA		
	L	77	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	41.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18733	T	12	NO OF TEETH	1006209828 1006209845 0001115047 0001115048 230311 15583	Mercedes:
	G	32.2	PINION DIA		
	L	49	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18734	T	13	NO OF TEETH		
	G	48	PINION DIA		
	L	110	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	72	CLUTCH O/D		
	CW		ROTATION		
FB-18735	T	19	NO OF TEETH	15020	带齿轮卡簧垫圈
	G	14.8	PINION DIA		
	L	110	LENGTH		
	SPL	4	NO OF SPLIN		
	ID		BUSHING DIA		
	D	56	CLUTCH O/D		
	CW		ROTATION		
 FB-18736	T	13	NO OF TEETH	ME700702 4-1111 54-8333 MT-34810B CSD-452	For: Mitsubishi 5.5kW, 6.0kW OSGR Starters Used On: Mitsubishi-Fuso Truck & other industrial applications Unit Nos: Mitsubishi M5T50177, M5T65071; Mitsubishi Motors ME049184, ME077044 LESTER: 17438/18165
	G	48	PINION DIA		
	L	110	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	72	CLUTCH O/D		
	CW		ROTATION		
 FB-18737	T	8	NO OF TEETH	190694 191775 594451 234996 2299 36-46-27 AS SD3030	VALEO : ALMERA - PRIMERA (1.5 - 1.6 - 1.8) - TINO
	G	27.2	PINION DIA		
	L	44	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		
 FB-18738 带齿头	T	18	NO OF TEETH		丰田凯美瑞
	G	12.7	PINION DIA		
	L	93.7	LENGTH		
	SPL	5	NO OF SPLIN		
	ID		BUSHING DIA		
	D	46	CLUTCH O/D		
	CCW		ROTATION		
 FB-18739	T	9	NO OF TEETH	31204P8AA01 54-8504	For: Mitsuba PMGR Starters Used On: (2002-98) Acura, Honda Unit Nos: Honda 31200-P8A-A01, 31200-P8F-A01; Mitsuba SM442-01, SM442-22 Lester Nos: 17728 WAI Ref. Nos: 2-1867-MT
	G	29.7	PINION DIA		
	L	95	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	61.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18740	T	11	NO OF TEETH	2250-95004 8970303930 HT-F1140BA FM 61257 1561257	HITACHI
	G	40.5	PINION DIA		
	L	132	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64.6	CLUTCH O/D		
	CCW		ROTATION		

 FB-18741	T	9	NO OF TEETH	1-21500-1720 1-21500-1900 1-21500-1910 5-81122-0080 NIK-207	600-813-2112 600-813-2150 600-813-2151 还要查下
	G	35.8	PINION DIA		
	L	63.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	58	CLUTCH O/D		
	CW		ROTATION		

 FB-18742	T	22	NO OF TEETH	G557	配 G3184 (7149) 齿头
	G	17.8	PINION DIA		
	L	108	LENGTH		
	SPL	5	NO OF SPLIN		
	ID		BUSHING DIA		
	D	66	CLUTCH O/D		
	CW		ROTATION		

 FB-18743	T	10	NO OF TEETH	2TO911335 35259430 35259760 35261302 35261360 1.01.1091.0	Lucas: VW 13190/ 15190 / 17210 motor MWM 229773
	G	37.8	PINION DIA		
	L	80	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18744	T	10	NO OF TEETH	2WO911335 35259440 35259770 35261303 1.01.1092.0	Volkswagen: Caminhões e ônibus c/ motor MWM, Ônibus 16210 com motor MWM - Ônibus 17210 com motor MWM - Ônibus 17220, com motor MWM Volvo: VM 17, VM 23, ambos com motor MWM
	G	37.8	PINION DIA		
	L	80.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	15	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18745	T	10	NO OF TEETH	F000AL0401 F000AL1682 F000AL1446 9001081446 1.01.1078.1 1.01.1222.0	Volkswagen: Gol II 1.0 MI., Gol III 1.0 16V Turbo., Gol III 1.0 MI., Gol III 1.0 MI 16V., Parati III 1.0 MI 16V., Parati III 1.0 MI 16V Turbo. ACE ELECTRIC 1012551
	G	27.8	PINION DIA		
	L	90	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	47.9	CLUTCH O/D		
	CCW		ROTATION		

 FB-18746	T	12	NO OF TEETH	35259460 1.01.1523.0	Ford: Ford Cargo 1217/1417/1421 Cummins Volkswagen: Caminhões com partida Prestolite, Titan, Trucks
	G	46.5	PINION DIA		
	L	78.5	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	15	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18747	T	10	NO OF TEETH	35259240 35260958 35261770 35262020 35262460 1.01.1604.0	Volkswagen: Bus with Cummins 6B Electronic 5.9 engine Zanella: Tractor 160 – PTRAC, Tractor 180 – PTRAC
	G	32	PINION DIA		
	L	77	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	15	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18748	T	10	NO OF TEETH	35259880 35260999 35261120 35261155 35262580 35259880 1.01.1623.0	Ford: Cargo With Engine Cummins ISBe 6 cil., F12000 With Engine Cummins B Eletronic, F14000 With Engine Cummins B Eletronic, F16000 With Engine Cummins B Eletronic Volkswagen: Truck with the Engine Cummins B Electronic
	G	32	PINION DIA		
	L	77	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18749	T	9	NO OF TEETH	35259680 35259750 35259938 35261299 35261355 35261425 1.01.1596.0	Agrale: TRACTOR 5075 E 5075.4 COM MOTOR BX 150, TRACTOR 5085 E 5085.4 COM MOTOR BX 150 Ford: PICK-UP F100 MWM X - 10 E 229, PICK-UP F1000 MWM X - 10 E 229, PICK-UP F14000 MWM X - 10 E 229, PICK-UP F150 / F250 / F3500 / F4000 / F7000 MWM X - 10 E 229 New Holland: Línea TL Exitus: TL65 / 75 / 85 / 95E MWM
	G	34.8	PINION DIA		
	L	80	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18750	T	9	NO OF TEETH	M191T18971	Mitsubishi: MOT20171
	G	29.5	PINION DIA		
	L	51	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CCW		ROTATION		
 FB-18751	T	9	NO OF TEETH	2195	MAHINDRA: FUORISTRADA
	G	27.8	PINION DIA		
	L	62	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		

 FB-18752	T	8	NO OF TEETH	26242078	KAPPA 1.2 LITRE PETROL ENGINE FITTED ON I 10 CAR
	G	28.4	PINION DIA		
	L	52.5	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	42	CLUTCH O/D		
	CW		ROTATION		
 FB-18753/7158	T	22	NO OF TEETH	28100-26238 G547	J08C、J07C,0355502001 /03555020041/ P13-MK35 HINO/MOTIR
	G	17.8	PINION DIA		
	L	127.6	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	64	CLUTCH O/D		
	CW		ROTATION		
 FB-18754	T	9	NO OF TEETH	CQ2011056	
	G	35.8	PINION DIA		
	L	50.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18755	T	11	NO OF TEETH	9003336206 132388 1.01.0706.0 lucas indiel 223854 AS-SD0049 SDV38037 1641	Alfa Romeo: Alfa 164TD, 33TD, 75TD, 90TD. fetta TD. Giulietta TD. Chrysler: Voyager 2.5 TD Peugeot: 306 XND, XRD, XRDT, 405D 1.9 Diesel
	G	29.5	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18756	T	10	NO OF TEETH	059427 059527 187528 594279 1.01.1458.0 139478 PG-F13025	Mercedes: CLASS C, E, M, S, V, CLK. SPRINTER, VITO ENGINE D/TD 438069
	G	27.8	PINION DIA		
	L	62	LENGTH		
	SPL	9	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18757	T	9	NO OF TEETH	1006209805 1006209814 1006209958 234946 AS-SD0138 SDV32256 62-42-15	ALFA ROMEO: 147 - 156 1.6 16V - 1.8 16V - 2.0 16V BMW: X3 2.0i - Z4 2.0i 116i - 118i - 120i - 318i - 320i - si FIAT: BARCHETTA - PUNTO HGT - STILO 1.8 16V LANCIA: LYBRA 1.8 16V - 2.0 20V
	G	29.7	PINION DIA		
	L	46	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18758	T	9	NO OF TEETH	79081045	Alfa Romeo: 30 - 32 - 35 - 40 (AR 8) Fiat: ARGENTA D, 131 D - 132 D, CAMPAGNOLA D Fiat Allis: FE 12/14/16 - FL 4C - FR 7-9, TRATTORI SERIE 46/66 OM: GRINTA 28.8 - 30.8 - 32.8 - 35.8 Seat: 131 D LESTER: 18092/18093
	G	34.8	PINION DIA	7984505	
	L	77.5	LENGTH	9961781	
	SPL	6	NO OF SPLIN	SD077	
	ID	14.3	BUSHING DIA	72159801	
	D	60	CLUTCH O/D	85540151	
	CW		ROTATION	MR-202	
				4-1122	
				132821	
				54-9307	
				1.01.0601.0	
				1573	

 FB-18759	T	10	NO OF TEETH	6033AD0243	MAN/BUSSING: 25t - L2000 - M2000 - EM - NM - SM,8t - 9t- 10t - 12t - 14t - 15t - 18t BOSCH0001231008 MAN51262017158
	G	37.8	PINION DIA	6033AD0306	
	L	83	LENGTH	9006033136	
	SPL	10	NO OF SPLIN	9006033306	
	ID	14.3	BUSHING DIA	234087	
	D	60	CLUTCH O/D	1.01.1178.0	
	CW		ROTATION	SDV38197	
				AS-SD0123	

 FB-18760	T	10	NO OF TEETH	105540	Citroën: Citroen BX 19 Diesel Peugeot: 205 diesel lucas indiel 223801 D9R084 AS-SD3005 SDV3772
	G	27.8	PINION DIA	182052	
	L	62	LENGTH	NE210	
	SPL	9	NO OF SPLIN	SD509	
	ID	12	BUSHING DIA	132020	
	D	54	CLUTCH O/D	1.01.0646.0	
	CW		ROTATION		

 FB-18761	T	8	NO OF TEETH	10475540	Daewoo: Damas Suzuki Series
	G	28.4	PINION DIA	31320-A80-B0	
	L	64	LENGTH	0	
	SPL	6	NO OF SPLIN	1.01.1620.0	
	ID	12	BUSHING DIA		
	D	43.5	CLUTCH O/D		
	CCW		ROTATION		

 FB-18762	T	9	NO OF TEETH		
	G	27.2	PINION DIA		
	L	43	LENGTH		
	SPL	6	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	43.5	CLUTCH O/D		
	CW		ROTATION		

 FB-18763	T	8	NO OF TEETH	1.01.0940.0	Asia Motors: Towner c/ motor Mando.
	G	24.9	PINION DIA	MT-120BA-1	
	L	70.5	LENGTH		
	SPL	4	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CCW		ROTATION		

 FB-18764 带齿头 ZP-7110	T	25	NO OF TEETH	26244192 M70GRS DRIVE ASSY 11 TEETH	M&M: LIGHT TRANSPORT VEHICLE
	G	18.2	PINION DIA		
	L	89.3	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	45.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18765	T	8	NO OF TEETH	F002G20594	
	G	28.4	PINION DIA		
	L	83.5	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	48	CLUTCH O/D		
	CW		ROTATION		
 FB-18766	T	9	NO OF TEETH	26242815	ASHOK LEYLAND HINO H SERIES 6 CYL. BUSES &TRUCKS
	G	36.8	PINION DIA		
	L	90	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	17	BUSHING DIA		
	D	61	CLUTCH O/D		
	CW		ROTATION		
 FB-18767	T	8	NO OF TEETH	MD620980 187077 594247 NE879 138113	MITSUBISHI MOTOR: CARISMA 1.6-1.8 NISSAN: BLUEBIRD 1.8 PRAIRIE 2.0 VALEO:D6RA76 PG-E82822 2035 36-46-10/SDV38155
	G	28.4	PINION DIA		
	L	51.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18768	T	10	NO OF TEETH	85541050 85540831 139900 MR-P115-1	BMW: 320 - 323 - 325 - 520 63223433 SDV32088 SDV38173 2090/ SD4030 21-41-18
	G	27.8	PINION DIA		
	L	52.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	48.6	CLUTCH O/D		
	CW		ROTATION		
 FB-18769	T	9	NO OF TEETH	1987BE0124 9945556 9948346 TMB009 85540971 85541780 1.01.0779.0 1.01.0865.0 135717 MR-W101	Fiat: Fiorino. Palio 1.0. Palio Weekend 1.5. Siena. Strada. Tipo 1.6.. Uno 21-41-15 SD4023 SDV38152 1929
	G	25.8	PINION DIA		
	L	64	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		

 FB-18770	T	9	NO OF TEETH		DENSO: 电装
	G	34.4	PINION DIA		
	L	42	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	45	CLUTCH O/D		
	CW		ROTATION		
 FB-18771	T	9	NO OF TEETH	85541280 85541710 85541870 139655 1.01.0999.0 MR-W102 21-41-19 232201 SD4027 LUCASINDIEL 224099	Fiat: Palio 1.6, Palio Weekend, Siena 16V 1.6. Strada. MARELLI 63101015/63101018/63101021/63101023/63102018/63102020/63102021/63102022/63103007/63103008/63103015/63103022/63103023/63103024
	G	23.8	PINION DIA		
	L	64	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		
 FB-18772	T	9	NO OF TEETH	85541080 MR-W101-925 1 138533 1.01.1484.0	Seat: Arosa 1.0 - 1.4L, Córdoba 1.0 - 1.4L, Ibiza II 1.0 - 1.4L Volkswagen: Lupo 1.0 - 1.4L, Polo 1.0 - 1.4L 63223039/63293029/63293039/SD4025 SDV38195/21-41-38/2099
	G	25.8	PINION DIA		
	L	60	LENGTH		
	SPL	12	NO OF SPLIN		
	ID	11.5	BUSHING DIA		
	D	46	CLUTCH O/D		
	CW		ROTATION		
 FB-18773	T	9	NO OF TEETH	6033AD0270 6033AD0414 9949055 233719 233921 234405 1.01.1022.0 BO-Z303-936 SD0103 SDV38046 64-42-02 2239	Agrale: Micro Ônibus Volare (Marcopolo) c/ motor MWM 407 TCA (a partir de 10/98). Fiat: Ducato Ford: F250 c/ motor MWM, F350 General Motors: Silverado c/ motor MWM MWM: Motor 6.07TCA (Ford F250 a partir de 03/99) c/ partida 0.001.003.010 Peugeot: Boxer 2.8 HDI
	G	35.8	PINION DIA		
	L	58	LENGTH		
	SPL	16	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18774	T	9	NO OF TEETH	16.901.694 139520 1.01.1616.0	CASE: 1394 - 1494 - 1594 - 1690 - 1694 - 1820 - TX36 HANOMAG: 1394 - 1494 - 1594 - 1690 - 1694 - 1820 - TX36 HY-MAC: 1080 - 1290 - 580 - 590 - 595 - 596 - 690 - 880C JCB: 420 - 430 - 807C - 811 - 812 - 814 - 817 - 818 LANDINI: MACCHINE AGRICOLE MOTORI PERKINS MASSEY FERGUSON: MACCHINE AGRICOLE MOTORI PERKINS NEW HOLLAND: MACCHINE AGRICOLE RENAULT M.A.: MACCHINE AGRICOLE MOTORI PERKINS
	G	35.8	PINION DIA		
	L	77	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		

 FB-18775	T	21	NO OF TEETH	1006209652 137891 1.01.1156.0 SD-2107 SD0076 SDV38190 2138 52-42-38	FORD(D): COURIER 1.3 FIESTA 1.0,FIESTA 1.3 KA 1.3i 0001107059/0001107082
	G	50	PINION DIA		
	L	47	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		
 FB-18776	T	9	NO OF TEETH	85541750 85541810 233946 SDV32095 21-41-40 2225	FIAT: BRAVO/A 100, MAREA 100 - MULTIPLA 1.6 16V, PALIO - SIENA - STRADA 1.6 16V 63111016/63111017/63111 036
	G	25.8	PINION DIA		
	L	48.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.5	CLUTCH O/D		
	CW		ROTATION		
 FB-18777	T	9	NO OF TEETH	028300-5720 ND-129A 54-8244 234230 1.01.0950.0 220-52036 SDND-2986 W475-165 61-29-14178	For: Nippondenso 0.7kW DD Starters Used On: John Deere 425 Lawn Tractor w/ Kawasaki Engine Unit Nos: Kawasaki 21163-2101, 21163-2114, 21163-2118; Nippondenso 128000-936, 228000-221
	G	29.5	PINION DIA		
	L	53.5	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	41.5	CLUTCH O/D		
	CCW		ROTATION		
 FB-18778	T	9	NO OF TEETH	1006209666 1006209791 1006209936 234158 1.01.1631.0 SDV38203 2296	Audi: A4 - A6 - A8 2.5 TDI – QUATTRO Skoda: SUPER B 2.5 TDI Volkswagen: PASSAT 2.5 TDI, SYNCRO - 4 MOTION
	G	32.3	PINION DIA		
	L	60	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	51	CLUTCH O/D		
	CW		ROTATION		
 FB-18779	T	9	NO OF TEETH	26243675	TATA MOTORS NANOPETROL 637CC
	G	25.8	PINION DIA		
	L	44	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	44	CLUTCH O/D		
	CW		ROTATION		
 FB-18780	T	10	NO OF TEETH	1.01.1566.0 5446-1570	Harley-Davidson: Harley Davidson. MY91 - 06 BT except MY06 Dyna
	G	27.8	PINION DIA		
	L	110	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.8	CLUTCH O/D		
	CW		ROTATION		

 FB-18781	T	40	NO OF TEETH	028301-0060 4-1063 54-82407 231944 ND-CGL 1.01.0884.1 1.01.1212.0	For: Nippondenso OSGR Starters Used On: (1998-92) Acura, Dodge Unit Nos: Nippondenso 228000-022, 228000-180, 228000-340 Lester Nos: 17273, 17549, 17574
	G	53.8	PINION DIA		
	L	80.5	LENGTH		
	SPL	10	NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		
 FB-18782 没孔	T	9	NO OF TEETH	HT-S0925A	
	G	25.8	PINION DIA		
	L	87	LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D	53.2	CLUTCH O/D		
	CCW		ROTATION		
 FB-18783 1.01.0567.0 加厚	T	9	NO OF TEETH	3-221 4-221 3-221HD 10499854 1852410 1852970 1930802 1941589 1946220 54-136 1.01.0052.0 10531/ D221 480468 E480320 3402/81886	Case: Pá Carregadeira c/ partida Delco. TCM Equipment Ag: Pá Carregadeira c/ partida Delco Remy. For: Delco 10MT, 22MT, 27MT, SD300 Series DD Starters Unit Nos: Delco 1107326, 590; 1108292, 393, 675; 1109362, 431, 432; 1998276, 335, 352, 365, 371, 384, 385, 506, 507, 597; 10455317, 321, 324, 325, 328, 332, 333, 340, 341, 351, 355, 356
	G	29.7	PINION DIA		
	L	96	LENGTH		
	SPL	3	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
FB-18784	T		NO OF TEETH		
	G		PINION DIA		
	L		LENGTH		
	SPL		NO OF SPLIN		
	ID		BUSHING DIA		
	D		CLUTCH O/D		
	CW		ROTATION		
 FB-18785	T	9	NO OF TEETH	9002336219 9002336238 9002336289 9003336289 230336 1.01.1070.0 BO-AH93522	Fiat: Ducato Ford: Maverick 2.7 d, 93 a 98 Nissan – Datsun: c/ partida Bosc 9000331201/9000331203 2019 SDV39239 SDV3903
	G	35.1	PINION DIA		
	L	62	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	54	CLUTCH O/D		
	CW		ROTATION		

 FB-18786	T	11	NO OF TEETH	16.901.752 230280 SD9006 SDV3909 GHIBAUDI215 6	HURLIMANN: 345 - 355 - 360 - 470 - 480 - 490 - 5110 6130 - 6160 - 358 - 476 - 488T - 496 6135 - 6136 - 6160 - 6190 LAMBORGHINI: 115 - 135 - 1356 - 1556 - 165 - 190 345 - 573 - 574 - 654 - 674 - 684 - 754 774 - 775 - 874 - R613DT - R653F - R714F SAME: ANTARES 110 - 130 - AURORA 45,BUFFALO 130 - CENTAURO 70,CENTURION 75 - CONDOR - CORSARO DRAGO - EXPLORER 55 - 65 - 75 - 85 STEYR-PUCH: 288 - 290 - 406 - 50 - 650 - 658,760 - 768 - 988
	G	40.5	PINION DIA		
	L	82	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18787	T	10	NO OF TEETH	16.903.392 234270 IS-202-2	MAN/BUSSING: L 4.6 - 5.7 - 6.6 - 6.9 11.130.534/11.130.537/11.130.783/11.130.784 SDV32226 GHIBAUDI2260 SD9008
	G	37.7	PINION DIA		
	L	82	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CW		ROTATION		
 FB-18788	T	13	NO OF TEETH	2006209329 4-1069 231886 54-9191 1.01.0727.0 BO-N3464A	ABG: MICKY 123 BOMAG: BW 90-SERIE 90 A-90T HATZ: Z 782-788-789-790 0001366103/0001366010 1913/6120-2211 HATZ49048300 BOMAG05726971 SAW-13958814 SDV38087
	G	46.7	PINION DIA		
	L	72	LENGTH		
	SPL	10	NO OF SPLIN		
	ID	14.3	BUSHING DIA		
	D	60	CLUTCH O/D		
	CCW		ROTATION		
 FB-18789 带齿头 ZP-7144	T	25	NO OF TEETH	26242435 M74GRS DRIVE ASSY	TATA: SAFARI DICOR - 2.2 LTRS
	G	18.2	PINION DIA		
	L	89.3	LENGTH		
	SPL	8	NO OF SPLIN		
	ID	12	BUSHING DIA		
	D	47.3	CLUTCH O/D		
	CCW		ROTATION		
 FB-18790	T	8	NO OF TEETH	028300-5800A	Suzuki: CARRY;MARUTI
	G	28.4	PINION DIA		
	L	75	LENGTH		
	SPL	5	NO OF SPLIN		
	ID	11	BUSHING DIA		
	D	41.5	CLUTCH O/D		
	CCW		ROTATION		